

GPOP - Issue Review System

Part Number: 68544198A\$

Part Description: PLATE, TORQUE CONVERTER DRIVE

Issue Description: For 3.6L with 62TE

NOTE: FOR ALL PROMASTER (VF) 3.6L/62TE EQUIPPED VEHICLES:
IF THE TRANSMISSION BRACKET TO THE TRANSMISSION CASE FASTENERS
ARE REMOVED DURING SERVICING, THE FASTENERS (Part Number
06511385A\$) ARE ONE TIME USEAGE & MUST BE REPLACED & PROPERLY
TORQUED TO 105NM

Replace the eight bolts (8) 06503465 drive plate to crank shaft and the four TC bolts
06504383 as they have sealants

Vehicle miles < 30K: Mandatory replacement of transmission and driveplate
Vehicle miles > 30K: Replace driveplate only (shot peened)

~ _____ ~
Contact us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP
Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the
Tech Tip you are referencing for our tracking system.
