



## STAR ONLINE PUBLICATION




**Case Number:** S2108000134

**Release Date:** June 2021


**Symptom/Vehicle Issue:** MIL (Malfunction Indicator Lamp) Illuminated, ETC (Electronic Throttle Control) Lamp Flashing

**Customer Complaint/Technician Observation:** Owner complains that the above warning lamps are on and the vehicle downshifts and has a limited throttle response and limited vehicle speed. Technician observed DTC's P2138, P2122, P2127 set as stored or active

**Discussion:** Inspect and secure any loose terminals for the involved APP circuits K29 and K23 and secure the connector D1563A as needed. Clear any stored DTC's and test the operation to complete.

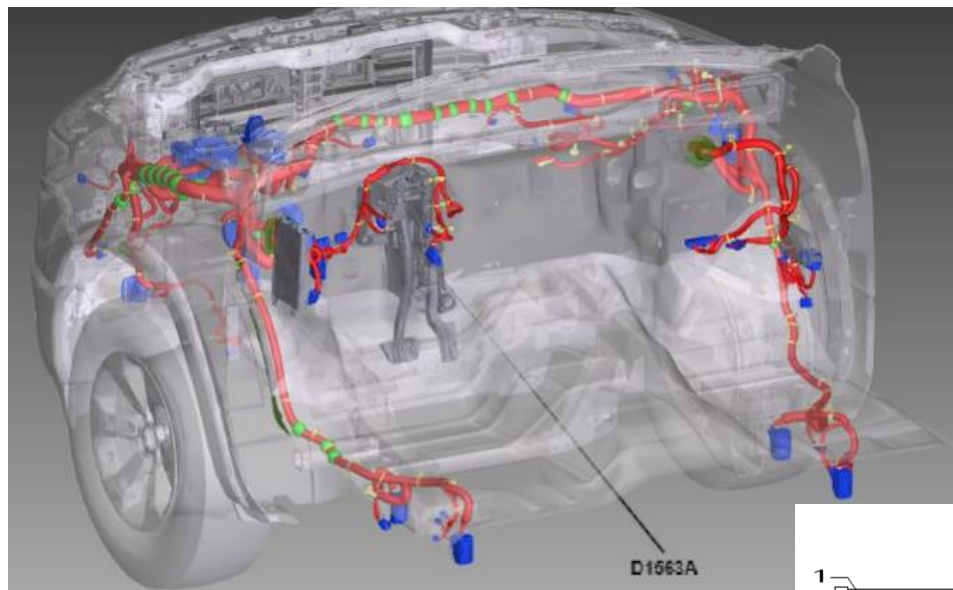

Pin	Circuit	Wire Color	Gauge/Size	Function
1	K854	VT/BN	0.3	5 VOLT SUPPLY
2	K852	CY/BU	0.3	5 VOLT SUPPLY
3	K23	BN/WH	0.3	APP SIGNAL 1
4	K167	BN/YE	0.3	APP SENSOR GROUND 1
5	K400	BN/VT	0.3	APP SENSOR GROUND 2
6	K29	WH/BN	0.3	APP SIGNAL 2

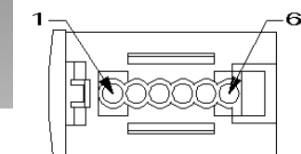

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**