



## STAR ONLINE PUBLICATION



**Case Number:** S1723000030 Rev A

**Release Date:** July 2021

**Symptom/Vehicle Issue:** Service Electric Park Brake Message

**Customer Complaint/Technician Observation:** Technician may find EPB Electric Park Brake Inoperative and DTC's C10D0 Electronic Park Brake Module Deactivated, C10EC-00 Park Brake Actuator Correlation, C008e-00 EPB ECU Internal Performance, C00CD-01EPB General Failure, C10ED-00 EPB LED

**Discussion:** Inspect rear vehicle wiring and the EPB module connector for pin issues- pin fit, pin backout, and corrosion. Inspect rear chassis grounds for cross threading tightness and good clean paint free connection.

Connector repair kit 68256811AA can be used to repair wiring issues at the EPB module connector.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**