



NUMBER: 18-044-21

GROUP: 18 - Vehicle Performance

DATE: May 5, 2021

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

This bulletin supersedes Technical Service Bulletins (TSBs) 18-005-18 REV. A, date of issue April 18, 2018, which should be removed from your files. All revisions are highlighted with **asterisks**** and include additional market, symptom/condition and LOP.**

SUBJECT:

Flash: Powertrain Control Module (PCM) Updates

OVERVIEW:

This bulletin involves reprogramming the Powertrain Control Module (PCM) with the latest available software.

MODELS:

2018 (BU) Jeep Renegade

NOTE: This bulletin applies to vehicles within the following markets/countries: North America and **EMEA****.**

NOTE: This bulletin applies to vehicles equipped with a 1.4L I4 Multiair Turbo Engine (Sales Code EAM).

SYMPTOM/CONDITION:

Customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation the technician may find the following Diagnostic Trouble Codes (DTCs) have been set:

- P1D7F-00 - ETC Self-Learning Failure. **(North America only)**.
- P0456-00 - EVAP Purge System Small Leak. **(North America only)**.
- P0441-00 - EVAP Purge System Performance. **(North America only)**.
- P0440-00 - General EVAP System Failure. **(North America only)**.
- P0455-00 - EVAP Purge System Large Leak. **(North America only)**.
- P1CEA-00 - Boost Side EVAP Purge System Performance. **(North America only)**.

In addition, the following software enhancement is available:

- ****After a short trip and shutting the engine off for 5-10 minutes, vehicle exhibits a long crank/start condition (EMEA only).****
- Updated EVAP system diagnostics. **(North America only)**.

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related vehicle systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the symptom/condition listed or if the technician finds the DTC, perform the Repair Procedure.

REPAIR PROCEDURE:

NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

NOTE: The clutch pedal learn routine must be performed post flashing the PCM.

1. Reprogram the PCM with the latest software. Detailed instructions for flashing control modules using the wiTECH Diagnostic Application are available by selecting the application's "HELP" tab.
2. Select topology screen.
3. Select the "PCM" icon.
4. Select "misc. functions" tab.
5. Select "clutch pedal learn" and follow all screen prompts.
6. Is the vehicle equipped with cruise control?
 - YES>>> Depress cruise on/off switch until the cruise indicator in the Instrument Panel Cluster (IPC) illuminates, then Press "OK" to continue.
 - NO>>> Press "OK" to continue.
7. Select the "topology" screen.
8. Clear all DTCs that may have been set in any module due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
18-19-06-JX	Module, Powertrain Control (PCM) - Reprogram (0 - Introduction)	1 - Engine Repair and Performance	0.3 Hrs.

NOTE: The expected completion time for the flash download portion of this procedure is approximately 8 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.

FAILURE CODE:

The dealer must use failure code CC with this Service Bulletin.

- If the customer's concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, failure code CC is to be used.
- When utilizing this failure code the 3C's (customer's concern, cause and correction) must be provided for processing Service Bulletin flash/reprogramming conditions.

CC	Customer Concern
----	------------------