



**NUMBER:** 18-051-21

**GROUP:** 18 - Vehicle Performance

**DATE:** May 22, 2021

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*

**This Technical Service Bulletin (TSB) has also been released as a Rapid Response Transmittal (RRT) 21-063, date of issue May 22, 2021. All applicable Sold and Un-Sold RRT VINs have been loaded. To verify this RRT service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty. This RRT will expire 18 months after the date of issue.**

**SUBJECT:**

Flash: Powertrain Control Module (PCM) Updates

**OVERVIEW:**

This bulletin involves reprogramming the PCM with the latest available software.

**MODELS:**

2021 (RU) Chrysler Pacifica (PHEV)

**NOTE:** This bulletin applies to vehicles within the following markets/countries: North America

**NOTE:** This bulletin applies to vehicles built on or before March 26, 2021 (MDH 0326XX) equipped with a 3.6L V6 PHEV Hybrid Engine (Sales Code EH3).

**SYMPTOM/CONDITION:**

Customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation the technician may find one or more of the following Diagnostic Trouble Codes (DTCs) have been set:

- P1AC6-00 - MCPA Crankshaft Position Signal Sensor Performance.
- P0335 - Crankshaft Position Sensor Circuit.
- P0339 - Crankshaft Position Sensor Intermittent.
- P0031 - O2 Sensor 1/1 Heater Circuit Low.
- P0032 - O2 Sensor 1/1 Heater Circuit High.
- P0037 - O2 Sensor 1/2 Heater Circuit Low.
- P0038 - O2-Sensor 1/2 Heater Circuit High.
- P0051 - O2-Sensor 2/1 Heater Circuit Low.
- P0052 - O2-Sensor 2/1 Heater Circuit High.
- P0057 - O2 Sensor 2/2 Heater Circuit Low.
- P0058 - O2-Sensor 2/2 Heater Circuit High.

**NOTE:** The following modules need to be flashed for this update to be effective, the following modules are all to be updated along with this PCM update:

- Hybrid Control Processor (HCP) and Auxiliary Hybrid Control Processor (AHCP) or also known as Power Inverter Module (PIM).

**DIAGNOSIS:**

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. If any vehicle not on the VIN list exhibits the symptom/condition or finds permanent fault codes stored, perform the repair.

**REPAIR PROCEDURE:**

**NOTE: The HCP and AHCP must be updated to the latest available software at the conclusion of this repair procedure. Refer to all applicable published technical service bulletins for detailed repair procedures and labor times regarding updating the HCP, AHCP software.**

**WARNING! Failure to update the HCP, AHCP modules following an PCM software update may result in vehicle malfunctions.**

**NOTE: Install a battery charger to maintain a 12 volt system voltage.**

**NOTE: If this flash process is interrupted/aborted, the flash should be restarted.**

1. Does the PCM control module have the latest software already installed?
  - YES>>> This bulletin has been completed, use inspect LOP (18-19-06-EC) to close the active RRT.
  - NO>>> Proceed to [Step 2](#).
2. Reprogram the PCM with the latest software. Detailed instructions for flashing control modules using the wiTECH Diagnostic Application are available by selecting the application's "HELP" tab.
3. Clear any DTCs that may have been set in any modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.
4. Verify the HCP, AHCP are also programmed with the latest available software. Refer to all applicable published service bulletins for detailed repair procedures and labor times regarding updating the HCP, AHCP software.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No:	Description	Skill Category	Amount
18-19-06-EC	Module, Powertrain Control (PCM) - Inspect (0 - Introduction)	1- Engine Repair and Performance	0.2 Hrs.
18-19-06-ED	Module, Powertrain Control (PCM) - Inspect and Reprogram (0 - Introduction)	1 - Engine Repair and Performance	0.3 Hrs.

**NOTE: The expected completion time for the flash download portion of this procedure is approximately 5 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.**

**FAILURE CODE:**

**The dealer must choose which failure code to use depending on if this is a Rapid Response Transmittal (RRT) or Service Bulletin.**

- The “RF” failure code is required for essential module flash/reprogramming and can only be used after confirmation that the VIN is included on the RRT.
- The failure code “RF” (Required Flash) can no longer be used on Service Bulletin flashes. **The “RF” failure code must be used on an RRT.**
- If the customer’s concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, failure code CC is to be used. When utilizing this failure code, the 3C’s must be supplied.

RF	Required Flash - RRT
CC	Customer Concern