



STAR ONLINE PUBLICATION



CHRYSLER

DODGE



Jeep



SRT


Case Number: S2108000167

Release Date: July 2021

Symptom/Vehicle Issue: Air Bag Lamp On, DTC B00DF-95 Passenger Restraints Disable Switch-Incorrect Assembly

Customer Complaint/Technician Observation: Owner complains of the cluster warning lamp that is on for the air bag system. Technician observed the vehicle is setting DTC - B00DF-95 Passenger Restraints Disable Switch-Incorrect Assembly. Validate the correct part is in the vehicle.

Discussion: Upon review of the vehicles equipment sales codes, the vehicle was not equipped with sales code (CGZ) Passenger Air Bag On/Off Switch. Inspect the involved dash harness for any damaged circuits that may be included in the harness but not used. Disconnect the circuits at the ORC as needed to validate any possible issues within circuits R167, R168. If the condition is no longer present when the circuit(s) are disconnected, further inspect to repair or isolate the disconnected circuit(s) at the module to complete.

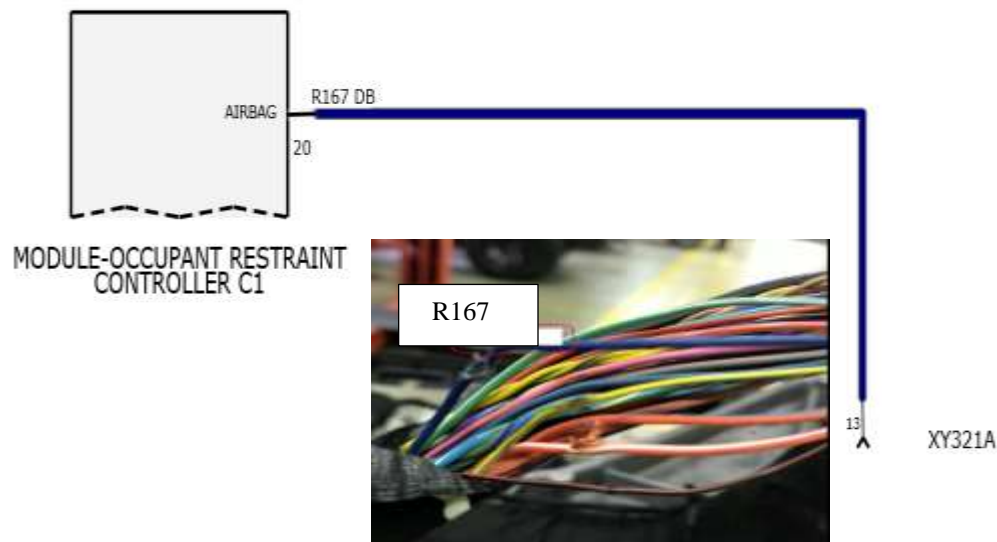

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found