



STAR ONLINE PUBLICATION



Case Number: S2108000175

Release Date: July 2021

Symptom/Vehicle Issue: Head Lamp Smart Lighting Module Left Or Right Locks Up After Flash, Head Lamps Will Not Turn On, Turn Signals Do Not Operate

Technician Observation: Headlamp or turn signal lamps do not operate after a flash update or a service repair. DTC P0602-00 Control Module Programming Error/Not Programmed sets in the SLML or SLMR.

Repair Procedure: Vehicle had recent service module update and the front headlamps and or turn signals no longer operate. SLML (Smart Lighting Module Left) or SLMR (Smart Lighting Module Right) can no longer be accessed and or head lamps or turn signals no longer operate. DTC P0602-00 is setting. This condition can only be corrected by replacing the headlamp assemblies with the listed DTC at this time.

NOTE: The lamp with the DTC P0602-00 should be repaired prior to any other communication faults set against the headlamp assembly that has the active DTC P0602-00.

Example of DTC's setting when a proxy alignment is required after replacing the headlamp or SLM module independently.

ECU	DTC CODE	DTC DESCRIPTION	STATUS
BCM	B2204-00	ECU Configuration Mismatch-	Active
SLML	B1684-13	Left Headlamp Leveling Motor Control-Circuit Open	Active

Witech folder:

 Guided Diagnostics

PROXI Configuration Alignment

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found