



NUMBER: 19-002-21 REV. A

GROUP: 19 - Steering

DATE: July 1, 2021

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

This bulletin supersedes Technical Service Bulletin (TSB) 19-002-21, date of issue June 17, 2021, which should be removed from your files. All revisions are highlighted with **asterisks**** and include updated part descriptions and markets.**

SUBJECT:

Noise In Steering Column Tailshaft When Turning Steering Wheel

OVERVIEW:

This bulletin involves inspecting and replacing the steering column if necessary.

MODELS:

2020 - 2021	(JL)	Jeep Wrangler
2020 - 2021	(JT)	Jeep Gladiator

NOTE: This bulletin applies to vehicles within the following markets/countries: North America, APAC, EMEA and LATAM.

NOTE: This bulletin applies to vehicles built on or after July 15, 2020 (MDH 0715XX) and on or before March 02, 2021 (MDH 0302XX).

SYMPTOM/CONDITION:

The customer may notice the following:

- A noise coming from the tailshaft of the steering column while turning.

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If Diagnostic Trouble Codes (DTCs) or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the symptom/condition listed above, perform the Inspection Procedure.

1. Use a stethoscope (or any other form of listening device available to use) to listen to the lower steering shaft near the energy absorbing slip joint, on the interior side, near the front bulkhead, while the steering wheel is being turned.
2. Is the noise coming from the energy absorbing slip joint area of the lower shaft?
 - YES>>> Proceed to [Step 1](#) of the Repair Procedure.
 - NO>>> This Bulletin does not apply. Normal diagnosis should be performed.

PARTS REQUIRED:

Qty.	Part No.	Description
1 (AR)	55057447AD (North America)**	**Steering Column - Tilt & Telescoping
1 (AR)	55057448AD (APAC, EMEA and LATAM)**	**Steering Column - Tilt & Telescoping LHD
1 (AR)	55057449AD (APAC, EMEA and LATAM)**	**Steering Column - Tilt & Telescoping RHD
4 (AR)	04749210AA	Nut, Hex Flange, M8 x 1.25 x 8.0 (Steering Column To Cross Car Beam)
1 (AR)	06512008AA	Bolt, M8 x 1.25 x 38 (Intermediate Shaft To Steering Column)
1 (AR)	06511578AA	Nut, Hex Lock, M16 x 1.50 (Steering Wheel To Column)

REPAIR PROCEDURE:

1. Replace the steering column assembly. Refer to the detailed service procedures available in DealerConnect> Service Library under: Service Info> 19 - Steering / Column / Removal and Installation.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
19-20-83-9D	Steering Column - Replace (2 - Skilled)	6 - Electrical and Body Systems	0.9 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------