

97-21-02TT - Fault code U019900, U020000, B101729, B101715, B103611, B103629 along with Various Warnings

Release date:

Transaction No:

1/14/2022

### Condition

### **ATTENTION:**

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.

TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

### **Applicable Vehicles**

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Atlas, Atlas Cross Sport, Golf, Golf Wagon, Jetta, Tiguan, Taos	2019-2022	All	All	All	All

Revision Table						
Instance Number	Published Date	Version Number	Reason For Update			
2065172/4	1/14/22	97-21-02	Include additional DTCs.			
2065172/1	11/12/21	97-21-02	Original publication.			

Various warning lights may illuminate, the windows may operate erratically, and several communication faults are stored.

# **Technical Background**

A poor connection in/at the door wiring harness may cause fault code U019900, U020000, B101715, B101729, B103611, and B103629 to be stored along with many other faults. This may also cause unwanted activation of certain vehicle systems, such as the windows opening/closing by themselves.

## **Service**

Check the wiring harness at the driver side A-pillar connection, both the door and body harness sides, for any pins that have poor terminal tension or pins that are backing out of their housing. While doing these checks, be sure to pay close attention to the Comfort CAN High and Low circuits as well as the circuits for the G179/G180. If there are any pin issues noted, replace the affected pins and retest. If there are not any pin fit issues, it is recommended to replace the affected door harness and retest.

### **Additional Information**

© 2022 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

.