

<b>Subject:</b>  SIDE PIPING PART OF FRONT SEAT BACK TRIM IS TORN	<b>Bulletin No.:</b> 09-002/22
	<b>Last Issued :</b> 01/18/2022

## BULLETIN NOTES

### APPLICABLE MODEL(S)/VINS

#### US Spec

2017 Mazda6 with VINS lower than JM1GL\*\*\*\*\*156205 (produced before December 29, 2017)

#### Mexico Spec

2017-2018 Mazda6 with VINS lower than JM1GL\*\*\*\*\*149891 (produced before November 1, 2017)

## DESCRIPTION

Some customers may complain about the poor appearance of the seat because the front seat back trim side piping is torn.



This is caused by the piping of the front seat back trim rubbing against clothes when passengers get in and out of the vehicle, fraying the seam, and resulting in protrusion of the plastic core wire.

Customers having this concern should have their vehicle repaired using the following repair procedure.

## REPAIR PROCEDURE

1. Verify the customer concern.
2. Replace the front seat back trim with the modified one according to the instructions on MGSS (FRONT SEAT BACK TRIM REMOVAL/INSTALLATION).

**NOTE:** The service part does not have a plastic core in the side piping of the seat back trim.

3. Verify the repair.

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

**PARTS INFORMATION****NOTE: DO NOT ORDER FOR STOCK. ONLY ORDER WHEN A VEHICLE IS IN THE DEALERSHIP FOR THIS ISSUE.**

Parts Number	Description	Qty.	Notes
GSY1-88-131-39	Trim (R), Seat Back	1	White
GSY1-88-181-39	Trim (L), Seat Back	1	White
GRY1-88-131-02	Trim (R), Seat Back	1	Black
GRY1-88-181-02	Trim (L), Seat Back	1	Black

**WARRANTY INFORMATION****NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	92
Damage Code	9A
Part Number Main Cause	****-88-131-** or ****-88-181-**
Quantity	1
Operation Number / Labor Hours:	XXT1YARX / 1.1 Hrs. (One side) XXT1YBRX / 2.0 Hrs (Both sides)

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.