

SSM 50386 - 2020-2022 F-Super Duty - 6.2L/7.3L - MIL On With DTC P0339 And/Or Runs Rough

Some 2020-2022 F-Super Duty vehicles equipped with a 6.2L or 7.3L gas engine may exhibit an illuminated malfunction indicator lamp (MIL) with diagnostic trouble code (DTC) P0339 stored in the powertrain control module (PCM) or the vehicle may exhibit a runs rough concern with no DTCs. This may be due to a concern with contamination on the crankshaft position (CKP) sensor. If pinpoint test JD in the Powertrain Control/Emissions Diagnosis (PC/ED) Manual leads to CKP sensor replacement, inspect the sensor for contamination and document the results in the warranty claim. Use causal part 6C315 and utilize labor operation 12650D57D in the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES

2020 - 2021 TRUCK: FE P558N SUPER DUTY
2020 - 2021 TRUCK: FE P558N SUPER DUTY
2022 TRUCK: FE P558N SUPER DUTY
2022 TRUCK: FE P558N SUPER DUTY