

# **Technical Service Bulletin**

#### 69 Front seat belt retracts slowly

69 22 77 2025730/2 January 25, 2022. Supersedes Technical Service Bulletin Group 70 number 11-23 dated March 15, 2011 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8	2006 – 2010	All	Not Applicable

### Condition

REVISION HISTORY					
Revision Date		Purpose			
2	-	Revised header (Corrected an Elsa display issue) Revised <i>Warranty</i> (Modified warranty table)			
1	03/15/2011	Initial publication			

#### **Customer states:**

• The customer may complain that the front seat belt may not retract, or it retracts slowly. This may occur on the driver's side and the passenger's side of the vehicle.

## **Technical Background**

The foam in the B pillar trim comes off, moves out of position, and interferes with the seat belt webbing.

The airbag safety system operates normally under this condition.

## **Production Solution**

The bonding of foam to the backside of the B pillar has been optimized.

### **Service**

1. Remove Lower B-Pillar trim according to ElsaWeb.

#### Page 1 of 3

© 2022 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



# **Technical Service Bulletin**

Repair Manual >> Body >> Body Interior >> 70 Interior Trim >> Lower B-Pillar Trim.

2. Re-bond the foam piece in the correct position of the backside of the B-Pillar.

## Warranty

Claim Type:	<ul> <li>If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li> </ul>				
Service Number:	7067				
Damage Code:	0010				
Labor Operations:	Remove and install B pillar trim	7067 1910	See SRT with associated operations		
	Modify B pillar trim	7067 4999	10 TU		
	- OR -				
	Remove and install 2 B pillar trims	7067 2010	See SRT with associated operations		
	Modify 2 B pillar trims	7067 4999	20 TU		
Diagnostic Time:	GFF	No allowance	0 TU		
	Road test prior to service procedure	No allowance	0 TU		
	Road test after service procedure	No allowance	0 TU		
Claim Comment: As per TSB 2025730					

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

<sup>© 2022</sup> Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prin expressed written permission of the publisher.



# **Technical Service Bulletin**

## **Required Parts and Tools**

# **Additional Information**

All part and service references provided in this TSB (2025730) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

© 2022 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.