



Technical Service Bulletin

91 Gateway sets DTC U164300 for the rearview camera, rearview camera functions normally
91 22 69 2065763/1 January 21, 2022.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3 and S3	2022	All	Rearview Camera

Condition

Customer states:

There is **NO** customer complaint as no functions or other electrical vehicle systems have any restrictions.

Workshop findings:

During PDI, maintenance, service visit, or a reset of terminal 30, the following DTC (static/intermittent) is logged in the data bus diagnostic interface -J533- (diagnostic address 0019):

- **DTC U164300:** Ethernet Rearview Camera System Control Module no communication (symptom number 2494569).

Technical Background

Communication deviation in reversing camera control unit J772 (diagnostic address 006C).

Production Solution

Not applicable.

Service

This DTC does **not** lead to a restricted function or a message in the instrument cluster. In this case, the rearview camera will continue to operate normally and this DTC should not be considered a problem.

- If there are no customer concerns and the RVC system operates normally, this fault should be ignored.
- If there is a customer concern for a RVC function, this DTC should only be considered a last resort in diagnosis. In this case, another root cause is likely. Continue with normal diagnosis.



Note:

Replacing the reversing camera -J772- or the data bus diagnostic interface -J533- will NOT clear this DTC, even if recommended by Guided Fault Finding.



Technical Service Bulletin

Warranty

This TSB is informational only and not applicable to any Audi Warranty.

Required Parts and Tools

Not applicable.

Additional Information

All part and service references provided in this TSB (2065763) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.