

SS 715-WST 2022 49X Transmission Cooler Line Plumbing Fitting

Applicable Vehicles

49X vehicles built with manual or automated manual transmissions.

Symptoms

Leaking transmission fluid, low fluid pressure, high fluid temperature.

Issue


Transmission cooler line plumbing fitting connections at the radiator may have relative movement between rail and radiator allowing fittings to become loose and leak.

Solution


Install parts below to existing trans cooler plumbing lines as shown (fwd and aft locations shown below):

TYCDCT110HIR Tie cable dual, .375 to 2.25 quantity(4)

23-09796-629 Clamp-cable tie,15", 0-4 bundle quantity(2)

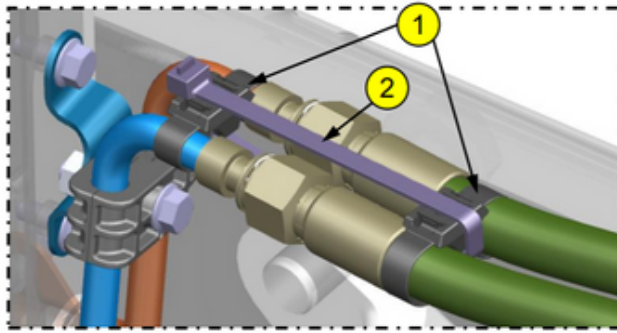

PULL ITEM #2 SNUG TO PROVIDE
SECONDARY RESTRAINT ACROSS
QUICK-CONNECT JOINTS.

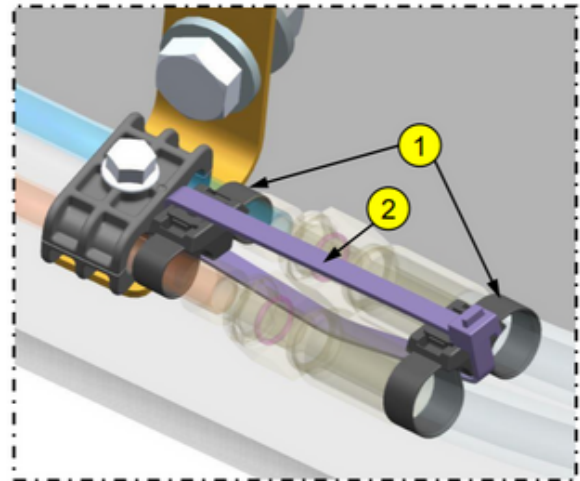

Labels :

49X

Add tags



0 Kudos

Comment