



Mack Chassis - Anthem (AN) - Hood Mounted Mirror Repair; Mirror Covers Loose, Rattling, Vibrating




> Internal Content

NOTE:

This modification is only valid for units built **Prior** to December 16 2019

Hood Mounted Mirror Modification

1. Lay out two 5/64" pilot holes on 2" centers 3/8" from the edge. A piece of painter's tape can be used to mark measurements.

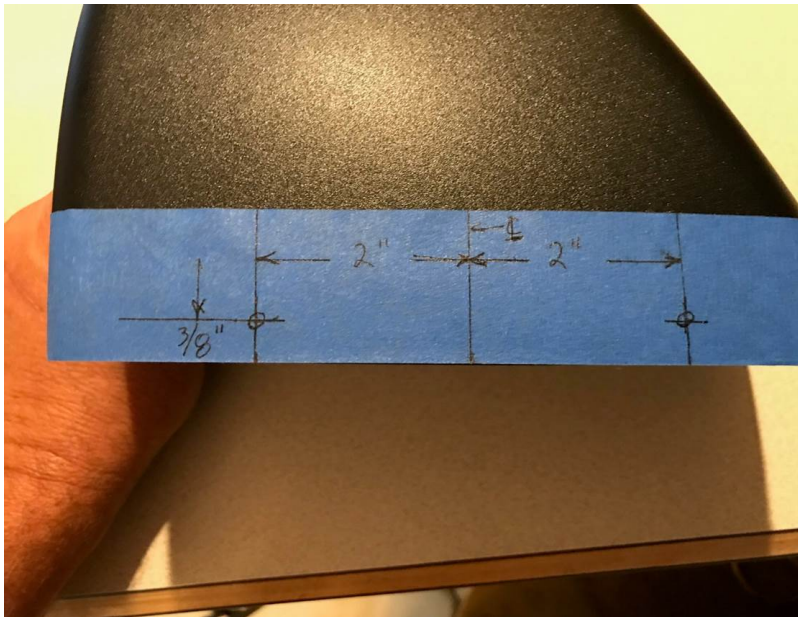


2. Transfer tape to the housing.

2.1 Align centerline with the middle mounting tab inside the housing.

2.2 Reinstall housing to the mirror.

2.3 Drill two 5/64" pilot holes in the housing and the mirror body.

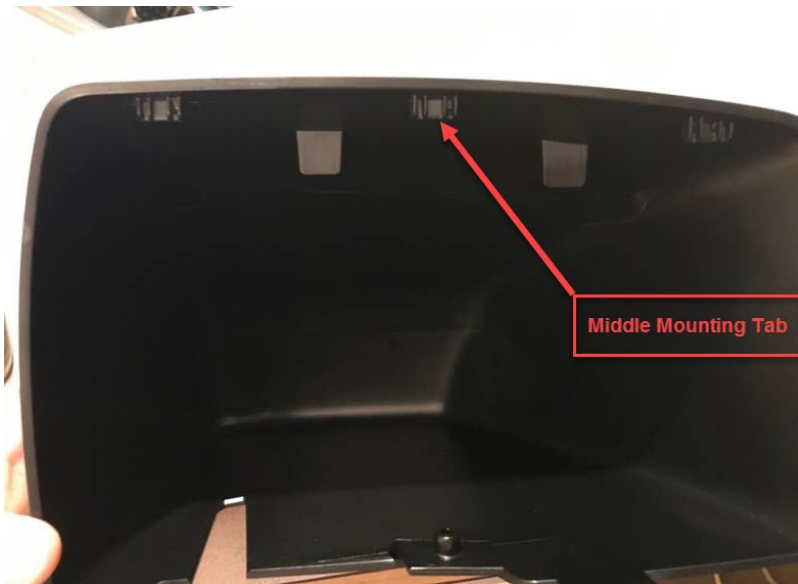

3. Remove housing and drill countersinks for #6-1/2 stainless steel screws.



4. Reinstall housing with original screw on the bottom and two (993622) screws at the top.

NOTE: Do not over tighten the screws.



Tags

[k82627508](#)

[mack](#)



External links and attachments



Feedback

No links or attachments available

[Give feedback](#)

to help improve the content of this article