

Accessory Heated Steering Wheel Does Not Work

AFFECTED VEHICLES

Year	Model	Trim Level
2022	MDX	Base, Tech

Editor's Note: This article revises the one posted in April 2021.

We've received reports that the accessory heated steering wheel does not work after installation. Our investigation has revealed that certain accessory kits may have the incorrect cable reel.

Before starting the installation, check to make sure you have a kit with the correct cable reel by inspecting the label on the steering wheel side. The correct cable reel will have (NR) on the label as shown below.

NOTE: The characters around (NR) will vary.



If you have a cable with a different label, return the kit to your parts department and use a different kit that has the correct cable reel. If no other kit is available, order the correct replacement cable reel, P/N 77900-TGV-D72.

END