



Technical Service Bulletin

GROUP CAMPAIGN	NUMBER 22-01-004H
DATE JANUARY 2022	MODEL(S) SANTA FE (TMa)

SUBJECT: ECU/TCU UPDATE – SHIFT BUMP AND HESITATION
(SERVICE CAMPAIGN T7S)

* IMPORTANT

*** Dealer Stock Vehicles Only ***

Dealers must perform this Service Campaign on all affected vehicles prior to customer retail delivery.

When a vehicle arrives at the Service Department, access the “Vehicle Information” screen via WEBDCS to identify open Campaigns.

DESCRIPTION: Certain 2022MY Santa Fe (TMa) vehicles may exhibit an intermittent shift bump and slight hesitation during low-speed acceleration. This bulletin provides the procedure to update the ECU and TCU software with revised logic to resolve these conditions.

APPLICABLE VEHICLES: Certain 2022MY Santa Fe (TMa) vehicles equipped with 8-speed wet Double Clutch Transmissions.

GDS INFORMATION: System Selection: **Engine:**

Event #	Description
777	777.TMa PE THETA 2.5TGDI 8DCT ACCELERATION LOGIC IMPROVEMENT (ECU)

GDS INFORMATION: System Selection: **A/T:**

Event #	Description
778	778.TMa PE THETA 2.5TGDI 8DCT ROUGH SHIFT AND HESITATION IMPROVED LOGIC (TCU)

WARRANTY INFORMATION:

Model	Op Code	Operation	Op Time	Causal Part	Nature Code	Cause Code
Santa Fe (TMA)	10DA39R0	ECU + TCU UPGRADE	0.5 M/H	39101-2STN7	I3T	ZZ3

NOTE 1: Submit claim on Campaign Claim Entry Screen.

NOTE 2: If a part that is not covered by this service campaign is found in need of replacement while performing the Service Campaign and the affected part is still under warranty, submit a separate claim using the same repair order. If the affected part is out of warranty, submit a Prior Approval request for goodwill consideration prior to the repair.

SERVICE PROCEDURE:**NOTICE**

You must initially perform GDS ECU and TCU Update in Auto Mode.

- If the TCU or ECU Update starts but then fails in Auto Mode, disconnect the battery cables, and touch the cables together for one minute. Reconnect the battery cables, attach a battery charger and perform the update in Manual Mode to recover.
- Refer to the General Instructions found in TSB 15-GI-001 (GDS Mobile).

After the TCU Update is completed, check for Diagnostic Trouble Codes, and erase any DTCs.

ECU ROM ID TABLE:

Model	Part Number		ROM ID	
	Old	New	Old	New
Santa Fe (TMa)	39101-2STN1	39101-2STN2	TMDWN5TMD3XXXJ1A	TMDWN5TMD3XXXJ1B
	39100-2STN1	39100-2STN2	TMDWN5TSD3XXXJ1A	TMDWN5TSD3XXXJ1B
	39101-2STN6	39101-2STN7	TMDWN5TMD3TXXJ1A	TMDWN5TMD3TXXJ1B
	39100-2STN6	39100-2STN7	TMDWN5TSD3TXXJ1A	TMDWN5TSD3TXXJ1B

TCU ROM INFORMATION TABLE:

Model	Part Number	ROM ID	
		Old	New
Santa Fe (TMa)	954A1-2N250	VTMPT25XXX720NS0	VTMPT25XXX800NS4
		VTMPT25XXX720NS1	
		VTMPT25XXX730NS2	
		VTMPT25XXX800NS3	

MANUAL UPDATE: If the TCU Update starts but then fails in Auto Mode, perform the update in Manual Mode to recover.

Model	System		Menu	Password
Santa Fe (TMa)	Engine	#777	TMa PE 2.5TGDI 8DCT 39101-2STN1	1210
			TMa PE 2.5TGDI 8DCT 39100-2STN1	1200
			TMa PE 2.5TGDI 8DCT 39101-2STN6	6210
			TMa PE 2.5TGDI 8DCT 39100-2STN6	6200
	A/T	#778	TMa PE 2.5TGDI 8DCT 3954A1-2N250	0522