

Front Brake Squeal/Squeak Noise

Service Category	Brake		Toyota Supports
Section	Brake (front)	Market USA	Toyota Supports

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION	
2020 - 2021	4Runner		

REVISION NOTICE

January 28, 2022 Rev2:

• The Production Change Information section has been modified. November 05, 2021 Rev1:

• The Production Change Information section has been modified.

Any previous printed versions of this bulletin should be discarded.

Introduction

Some 2020 – 2021 model year 4Runner vehicles may exhibit a squeal/squeak noise from the front brakes with light to moderate braking. Follow the Repair Procedure in this bulletin to address this condition.

Front Brake Squeal/Squeak Noise

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PLANT	PRODUCTION CHANGE EFFECTIVE VIN		
		JTEDU5JR#M5250665		
		JTEEU5JR#M5250665		
		JTEFU5JR#M5250665		
		JTEZU5JR#M5250665		
		JTEBU5JR#M5964996		
		JTEKU5JR#M5964996		
(Durner	Tahara	JTELU5JR#M5964996		
4Runner	Tahara	JTEMU5JR#M5964996		
		JTENU5JR#M5964996		
		JTEPU5JR#M5964996		
		JTERU5JR#M5964996		
		JTECU5JR#M5250665		
		JTEHU5JR#M5964996		
		JTEJU5JR#M5964996		

Warranty Information

OP CODE	DESCRIPTION	ТІМЕ	OFP	T1	T2
473301	R & R Front Brake Pads	0.8	04465-35330	36	50

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Front Brake Squeal/Squeak Noise

Parts Information

PART NUMBER	PART NAME	QTY
04465-35330	Pad Kit, Disc Brake, FR	1

NOTE

Confirm the lot number on the pad kit packaging is AFTER 07/23.

For example: $G23 - July 23^{rd}$ (G = July, $23 = 23^{rd}$ day of the month).

Figure	1	Pad	Kit	Pack	ragin	n
iguic		I UU	I VIC	1 401	ugin	9

PAD KIT, DISC BRAKE CB	
₩04465-35330	
GTY: 7 G G23	
CENTREMARKE GENUINE PARTS TOYOTA MOTOR CORPORATION MADE IN JAPAN	

Repair Procedure

1. Confirm the condition exists.

Does the vehicle exhibit a squeal/squeak noise from the front brakes with light to moderate braking?

- YES Continue to step 2.
- NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- 2. Replace the front brake pads.
 - A. Remove the front brake pads.

Refer to TIS, applicable model and model year Repair Manual:

- 2020 2021 4Runner: Brake – Brake (Front) – "Brake (Front): Front Brake: <u>Removal</u>"
- B. Install the NEW front brake pads.

Refer to TIS, applicable model and model year Repair Manual:

- 2020 2021 4Runner: Brake – Brake (Front) – "Brake (Front): Front Brake: Installation"
- 3. Test-drive the vehicle to confirm proper brake pad installation.