



Bulletin No.: PIT5855B

Published date: N/A

Preliminary Information

PIT5855B Heated and Ventilated Seats Inoperative

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT5	2021	All	All	All	All
Cadillac	XT6	2021	All	All	All	All

Involved Region or Country	North America
Condition	Both front heated and ventilated seats inoperative. On further inspection it may be found that fuse F19DA is open. If the fuse is replaced it may be okay for a while or it may immediately go open again.
Cause	Circuit 639 shorted to ground on the driver or passenger seat back frame.

Correction:

Remove the front passenger seat back cover.

Inspect the harness that goes to the seat back blower for chaffing on the seat back frame in the areas shown below.

If no damage is found to the circuits in the passenger seat back, inspect the driver's seat

back in the same areas.



The harness may need to be moved to see the area that is damaged.



If no damage is found in this area, also inspect the harness along the side of the seat frame as shown in the two photos below.





Repair the damaged circuits following the correct procedure in SI for wire and connector repair.

Version History

Version	2
Modified	09/23/2021 - Created on. 11/03/2021- Added XT5 and additional pictures 01/04/2022- Added direction to also inspect the driver's seat back in the same areas



GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.