



Preliminary Information

PIT5807A Unwanted Content Theft Alarm Activation

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade Models	2021	SOP	11/2/2020	All	All
Chevrolet	Suburban	2021	SOP	11/2/2020	All	All
Chevrolet	Tahoe	2021	SOP	11/2/2020	All	All
GMC	Yukon Models	2021	SOP	11/2/2020	All	All

Involved Region or Country	North America
Additional Options (RPO)	With RPO UTV: Vehicle Interior Movement Sensor Note: Maybe included in Security Packages such as RPO's UTR and NWM
Condition	Some customers may comment on the vehicle's content theft alarm (horn and lights) randomly sounding off for no reason. In some cases, there may be DTC B192A set.
Cause	The cause of this condition could be the B165 Content Theft Deterrent Sensor being too sensitive.

Correction:

To correct this concern, reprogram the BCM with the latest calibrations available in Tis2Web. All vehicles built after 11/2/2020 already have the updated BCM calibration and do not require reprogramming. For all vehicles which already have the updated BCM calibration, if you experience this concern please follow normal SI diagnostics.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2810215	Body Control Module Reprogramming with SPS	Use Published Time

Version History

Version	2
Modified	01/25/2021 - Created on. 08/09/2021 - Add a break point to the models and update the correction section.



GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.