



Preliminary Information

PIT5474D Service Engine Soon MIL on, Service Power Steering Message Loss of Assist or Loss of Power with Multiple U-Codes Stored or C0800

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2015 - 2021	All	All	All	All
GMC	Canyon	2015 - 2021	All	All	All	All

Supersession Statement

This PI was superseded to update model years and add possible conditions. Please discard PIT5474C.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern

The customer may state there is a Service Engine Soon MIL on, a Service Power Steering message, loss of power and/or MIL's on in the IPC. The technician may find codes C0800, U0073, U0102, U0109 and/or U0140 stored.

Recommendations / Instructions

Inspect terminals for circuits 2500 and 2501 at X103 and X106 and on a 4WD, the TCCM connector X2 (the terminals need to be removed from X2 to test properly) Testing for oversized or bent terminals. Inspect Power Steering sub harness between the PSCM and X103 for damage. Repair per eSI if there is an issue found.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



GENERAL MOTORS