

Technical Service Bulletin

91 Driver Assist Systems sporadically inop (DTC B200FF0 / B2F0100) 91 22 78 2066181/1 February 18, 2022.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3 and S3	2022 – 2023	All	Not Applicable
R S3	2023		

Condition

Customer states:

The driver assist systems are sporadically unavailable and/or one of the following messages is displayed in the instrument cluster:

- Adaptive Cruise Control not working
- Lane assist: currently unavailable. See owner's manual
- Audi pre sense: currently restricted. See owner's manual
- Audi pre sense not working

After a few moments or after cycling the ignition off and on, the instrument cluster messages disappear and the driver assist systems become operational again.

Workshop findings:

The following DTCs are stored sporadically in the front camera for driver assist systems, R242 (address word 00A5).

• DTC B200FF0: Internal malfunction (symptom code: 1124116)

and/or

• DTC B2F0100: Development code 1 (symptom code: 1124198)

Technical Background

Highly sporadic system resets of the image processing unit may cause the driver assist systems to intermittently become inoperable for a short period of time.

Production Solution

Not applicable.

^{© 2022} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

Service

No repair is available at this time.

- 1. Do not perform any repairs. Any repairs for this concern may be denied.
- 2. Instruct the customer that this condition is normal.

Warranty

This TSB is informational only and not applicable to any Audi Warranty.

Additional Information

All part and service references provided in this TSB (2066181) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

© 2022 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.