



# Technical Service Bulletin

---

**93 Red drive system fault warning lamp DTC: P060C00 is stored in the ECM  
93 22 67 2066072/1 February 9, 2022.**

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e- tron GT	2022	All	Not Applicable

## Condition

Customer states:

- Red drive system warning lamp comes on.

Workshop findings:

The following DTC may be stored engine control module (ECM), J623 (address word 0001):

- DTC P060C00: Internal Control Module Main Processor Performance, with symptom code 39722.

## Technical Background

Software issue.

## Production Solution

New software in production.

## Service

- If you have confirmed the condition above check the software part number and software version number of the Engine Electronics control unit (ECM), J623 (address word 0001) (Figure 1).



# Technical Service Bulletin

Address: 0001 System name: 0001 - Engine Electronics Log versions: UDS/ISOTP

[-] Identification:	
Data source:	Vehicle
Hardware part number:	9J1907522
Part number:	9J1907558B
Hardware version number:	H02
Software version number:	0002

Figure 1. Engine Electronics part number and software version.

- If the installed Software part number is 9J1907558A or 9J1907558B proceed with the TSB and update the software.
- If the installed Software part number is 9J1907558C or 9J1907558D this TSB does not apply and you should continue with your diagnosis.

## SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the Engine Electronics Control Unit (J623) using the SVM action code as listed in the table below, if necessary:



Tip:

Before entering the SVM code the transmission must be in Park "P"



Note:

To prevent the high-voltage battery from charging during the software update, the high-voltage charging cable on vehicles with high-voltage components must be unplugged ***BEFORE*** the SVM code is entered. Charging the high-voltage battery during a software update can cause damage to the high-voltage components.

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
e-tron GT	9J1907558A	0002	9J1907558C	0003	01A293



# Technical Service Bulletin

RS e-tron GT	9J1907558B	0002	9J1907558D	0003	
--------------	------------	------	------------	------	--

## Warranty

Claim Type:	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• G10 for CPO vehicles – Verify Owner</li><li>• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>		
Service Number:	9370		
Damage Code:	0041		
Labor Operations:	Software Update	0151 0000	Time stated on diagnostic protocol (Max 50 TU)
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 20 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
Claim Comment:	As per TSB 2066072/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information



# Technical Service Bulletin

---

All part and service references provided in this TSB (2066072) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.