


ASCM display - flickering at elevated interior temperatures

Topic number	LI82.90-P-074451
Version	1
Function group	82.90 - On-board communications system, multifunction steering wheel, central control functions
Date	2/24/22
Validity	Model series 213 and 238 with code U88
Reason for change	null

Complaint

Customer may state that at interior temperatures greater than 40°C/105°F the ASCM control unit (A74/2) display flickers

Attachments	
File	Description
ASCM flickering.png	Examples of complaint
	

Cause

A delay with display initialization during start-up

Remedy

Perform a software update of the ASCM control unit (A74/2)

Note: Do not replace parts for this complaint

Symptoms
Body > Interior equipment > Switches, interior, general > Malfunction
Overall vehicle > Networking > Combination switch > Function error
Communication/information > Information display > Indicator lamp > Malfunction
Communication/information > Information display > Indicator lamp > Flickers/pulsates
Control unit/fault code

XENTRY TIPS

Control unit	Fault text
N80 - Steering column module (SCM)	<p>B150464 - The left multifunction steering wheel button group has a malfunction. There is an implausible signal.</p> <p>B150486 - The left multifunction steering wheel button group has a malfunction. There is an incorrect signal.</p> <p>B150487 - The left multifunction steering wheel button group has a malfunction. The message is missing.</p> <p>B150496 - The left multifunction steering wheel button group has a malfunction. There is an internal component fault.</p> <p>B150564 - The right multifunction steering wheel button group has a malfunction. There is an implausible signal.</p> <p>B150586 - The right multifunction steering wheel button group has a malfunction. There is an incorrect signal.</p> <p>B150587 - The right multifunction steering wheel button group has a malfunction. The message is missing.</p> <p>B150596 - The right multifunction steering wheel button group has a malfunction. There is an internal component fault.</p>
N80 - Steering column module (SCM)	<p>B150464 - The left multifunction steering wheel button group has a malfunction. There is an implausible signal.</p> <p>B150486 - The left multifunction steering wheel button group has a malfunction. There is an incorrect signal.</p> <p>B150487 - The left multifunction steering wheel button group has a malfunction. The message is missing.</p> <p>B150496 - The left multifunction steering wheel button group has a malfunction. There is an internal component fault.</p> <p>B150564 - The right multifunction steering wheel button group has a malfunction. There is an implausible signal.</p> <p>B150586 - The right multifunction steering wheel button group has a malfunction. There is an incorrect signal.</p> <p>B150587 - The right multifunction steering wheel button group has a malfunction. The message is missing.</p> <p>B150596 - The right multifunction steering wheel button group has a malfunction. There is an internal component fault.</p>

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note