

Reference	SSM75685
Models	Defender / L663
Title	Defender 23MY (L663) Loadspace floor trim panel out of alignment
Category	Body
Last modified	18-Feb-2022 00:00:00
Symptom	107000 Interior Trim
Attachments	SSM75685 L663 Loadspace floor Panel attachment.pdf (SSM75685 L663 Loadspace floor Panel attachment.pdf)
Content	<p>Issue: Loadspace floor trim and stowage tray may not fit correctly into position. The trim may appear to be slightly raised at the left hand rear corner. The issue will only appear when fitting a Deployable Side Step (DSS) module as an accessory option where the vehicle has been supplied with a factory fit tow bar module.</p> <p>Cause: Change to design of towbar/ deployable side step module bracket at 23MY that may contact the lower face of the stowage tray causing a slight elevation of the loadspace floor trim.</p> <p>Action: If after fitting a deployable side step module as an accessory option, it may be necessary to remove a small portion of material from the lower face of the stowage tray to ensure the tray fits correctly into position.</p> <ol style="list-style-type: none"> 1. Remove loadspace floor panel 2. Remove stowage trim 3. Refer to the attachment that shows the material requiring removal using a suitable tool. <p>Note: There are two designs of stowage trim that may be fitted (part numbers and images shown in figures 1 and 4).</p> <p>Note: Figure 3 dimension 'A' requires material to be removed to a depth where it is level with the main surface.</p> <ol style="list-style-type: none"> 4. Refit stowage trim. 5. Refit loadspace floor panel.

anBhdhRlcnM7MjAyMl0wMy0wNF0xNjozMjoyOS44MzFaOzE2NS4yMjUuNjEuMTg0Ow==