



# Preliminary Information

## PIT5892 Wipers Do Not Park in Correct Location After Using Washers Or Mist Function of Wiper Switch.

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade Models	2022	All	All	All	All
Chevrolet	Suburban	2022	All	All	All	All
Chevrolet	Tahoe	2022	All	All	All	All
GMC	Yukon Models	2022	All	All	All	All

Involved Region or Country	North America
Condition	Some customers may comment that the front windshield wipers do not park in the correct location at the bottom of the windshield after using the washer or Mist Function of Wiper Switch.
Cause	This is due to a software issue with the wiper system

**Correction:**

If you experience this concern, do not replace any parts on the vehicle. Updated software is being released to repair this issue and this PI will be updated when the software is released.

**Note: In the meantime, a temporary work around for this condition has been developed below:**

- 1) Ignition/Vehicle OFF, all access doors closed, all vehicle systems OFF, and all keys at least 3 m (9.8 ft) away from vehicle. Disconnect the scan tool from the vehicle if one is attached. Let the vehicle sit for 10 min to allow all vehicle systems to power down.
- 2) Disconnect the 12V battery for 2 Minutes
- 3) Reconnect 12V battery and verify all wiper washer functions work properly

Version History

Version	1
Modified	02/08/2022 - Created on



GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.