

57-21-01TT - MQB Vehicle, KESSY Key Adaptation, No Terminal 15 Ignition ON Status

Release date:

**Transaction No:** 

03/10/2022

## Condition

#### **ATTENTION:**

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.

TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

### **Applicable Vehicles**

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf, GTI, Golf R, eGolf, Golf SportWagen	2015 -2021	All	All	All	All
Atlas, Tiguan LWB	2018 - 2021	All	All	All	All
Atlas Cross Sport	2020- 2021	All	All	All	All
Jetta	2019 - 2021	All	All	All	All
Arteon	2019 - 2021	All	All	All	All
Taos	2022	All	All	All	All

Revision Table						
Instance Number	Published Date	Version Number	Reason For Update			
2062139/4	3/10/22	57-21-01TT	Include Taos applicability.			
2062139/3	2/26/21	57-21-01TT	Additional statement on connectivity.			
2062139/1	1/29/21	57-21-01TT	Original publication.			

# **Technical Background**

KESSY equipped vehicles may not have any original keys. With a replacement KESSY key, there is no activation of terminal 15 or ignition. ODIS may not scan vehicle and / or switch terminal 15 / ignition on after key adaptation.

### **Service**

ODIS must show connection to internet services. It's not necessary to activate the flash to pass, brake pedal, hazards or jumping terminal 15 relay for this recommendation. Start a new vehicle scan and when ODIS displays the VIN, on that screen uncheck working with GFF guided fault findings. Then continue with vehicle scan under the Special Function tab run the Adapt Immobilizer test plan. When the test plan asks if you want to adapt keys, remove fuse SC19 for 30 seconds, re-install and continue with the key adaptation, making sure the reader coil is exposed and keys are put flat against the reader coil while adapting.

## **Technical Tip**



57-21-01TT - MQB Vehicle, KESSY Key Adaptation, No Terminal 15 Ignition Release date: 03/10/2022

**ON Status** 

## **Additional Information**

© 2022 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

2

**Transaction No:** 

2062139/4