



# Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-22-16

Subject: Software Version Update, Enhancements and Fixes

Date: Mar. 9, 2022

## **Supersedes VOS-22-03 due to new diagnostic content**

The following ODIS Service software versions are available for download.

Current ODIS Service Software Versions	
Application: <b>V9.1.0</b>	Diagnostic Content: <b>V2.45.1</b>

### **Key Fixes/Enhancements for Diagnostic Content: V2.45.1:**

#### **1. AJ - Jetta SportWagen 2010 – 2014, CJAA 2.0 L TDI CR / 103 kW**

Starter test SYS27\_\_XX\_XXX\_1\_0610\_66\_Anlasser\_pruefen\_00066 Test step: Checking starter speed. Starter did not turn but test states- The voltage at the magnetic switch of the Starter is 13.1 V and is OK.

#### **2. A3 - Passat/New Midsize Sedan 2011 – 2021, DTDA 2.0TL**

P24D700: EVAP System Pressure Sensor/Switch "B" Circuit Low active/static, no test added to current test plan.

#### **3. A3 - Passat/New Midsize Sedan 2011 – 2021, DTDA 2.0TL**

P04F000: EVAP system high pressure purge line performance  
SYS\_X\_1\_0921\_11\_X\_X\_FSK\_ESY\_V700\_Pumpe\_fuer\_Luftspuelung\_des\_Aktivkohlefilters\_FS\_00000 malfunctions.

- The basic setting was not completed successfully.
- Send feedback once test has ended.

#### **4. A3 - Passat/New Midsize Sedan 2011 – 2015, CKRA 2.0 L TDI-CR / 103 kW**

P241300: Exhaust Gas Recirculation System Performance is active/static but no test created in current test plans for the fault code.

(cont.)



# Service Information

---

## 5. CL - Taos 2022

P253300: Ignition Switch Run/ Start Position Circuit

SYS\_X\_1\_0717\_11\_X\_X\_SSG\_XX\_FSB\_Startersteuerung\_00011 test.

- Test step checking harness connection calls out Access/start authorization control module J518 but the wiring diagram calls out J965 access/start system interface.

## 6. E2/E3 - ID.4 2021

B1225F1: Passive occupant detection system mat Shield wire, open circuit but no test is created in current Test Plans.

## 7. E2/E3 - ID.4 2021

P30A000: Intermediate circuit condenser not discharged is active in 00CE - Electric Drive 2 but no test created in current- Test Plans.

## 8. CD/CG Golf 2022

P176F00: Clutch 2 closes unintentionally and P060700: Control Module Performance is active/static in the TCM but no test is created for the fault codes in the current Test Plans.

## 9. CD/CG Golf 2022

Guided functions greyed out and not available for 0002 - 7-speed automatic transmission - DSG 0GC.

## 10.E2/E3 - ID.4 2021

P30A000: Intermediate circuit condenser not discharged is active in 00CE - Electric Drive 2 but no test created in current- Test Plans.

## 11.General translation errors.