



Service Bulletin

Bulletin No.: 22-NA-047

Date: March, 2022

INFORMATION

Subject: Information on Coolant Loss and/or Coolant Odor

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	CTS	2016	2019			LT4	
	Escalade Models	2015	2021			L83, L86, L87	
Chevrolet	Camaro	2016	2021			LT1, LT4	
	Corvette	2016	2019			LT1, LT4	
	Silverado	2014	2018			LV3 L82 L83 L84 L86 L87	
	Silverado 1500 (New Model)	2019	2021				
	Silverado LD	2019	2019				
	Suburban	2015	2021			L83 L84 L87	
	Tahoe	2015	2021			L83 L84 L87	
	GMC	Sierra	2014			2018	
Sierra 1500 (New Model)		2019	2021				
Sierra Limited		2019	2019				
Yukon Models		2014	2021			L83 L84 L86 L87	

Involved Region or Country	North America, Europe, Russia, Middle East, Israel, Palestine, Argentina (Mercosur), Brazil (Mercosur), Chile (West), Colombia (West), Ecuador (West), Paraguay (West), Peru (West), Uruguay (West), Japan, Cadillac Korea (South Korea), GM Korea Company, China - SGM, Thailand (ASEAN), Australia/New Zealand
Condition	Some customers may comment that on one or more of the following conditions after driving the vehicle for a period of time: <ul style="list-style-type: none">• Coolant loss• Coolant odor from under the hood.

Information



5994860

This condition may be caused by a coolant leak at the outer head bolt boss (1) on the cylinder head:

⇒ To verify this condition, pressure test the cooling system and inspect for a leak in this area. Streaks may also be noticed running down the side of the boss/head as well. Examples of leak are shown above.

If a leak is found in this area it may be caused by porosity within the right or left cylinder head and may require replacement.

Version	1
Modified	Released March 02, 2022