

**N222363820 – Driver’s Side Rear Wheel Liner Instructions**

**Vehicles Involved: 2022 Chevrolet Blazer**

**IMPORTANT Information**

The referenced vehicles were placed on Stop Delivery on March 17, 2022, or March 21, 2022. The following steps will be required to release these vehicles for sale.

1. The Driver’s Side Rear Wheel Liner will be sent to your Dealership Parts Department (ATTN: Parts Manager) for installation on these vehicles (over the next few days). Note: The Wheel Liner part and Attachments will be sent at no charge. The involved VIN(s) and a copy of this Instruction Form for N222363820 will also be included for informational purposes with the part shipment.
2. Once the parts have arrived, follow the Service Procedure Instructions below to complete the wheel liner installation.
3. **IMPORTANT:** Once the wheel liner installation is complete, submit a transaction into GWM using the labor operation 9106206 and note these special instructions (**a. and b.**).
  - a. **Do Not Submit for Part Cost - Submit for the dealer parts handling allowance ONLY in Misc. Net Items. (\$177.75 multiplied by your approved parts handling allowance. Example - Part Handling Allowance: \$177.75 x 40% = \$71.10).**
  - b. **Note: Submitting a part number on the transaction will result in claim rejection.**

**Part Information**

<b>Quantity</b>	<b>Part Name</b>	<b>Part Cost</b>
1 pkg	Rear Wheelhouse Liner Installation Kit	\$0.00


**Warranty Information**

Submit a transaction in GWM using the table below. All transactions must be submitted as a ZFAT transaction type.

<b>Labor Operation</b>	<b>Description</b>	<b>Labor Time</b>	<b>Trans. Type</b>	<b>Net Item/Misc.</b>
9106206	Left Rear Wheelhouse Liner Installation/Area Inspection	0.3	ZFAT	N/A

**Service Procedure**

1. Lift the vehicle. Refer to *Lifting and Jacking the Vehicle* in SI.
2. Remove the left rear wheel. Refer to *Tire and Wheel Removal and Installation* in SI.

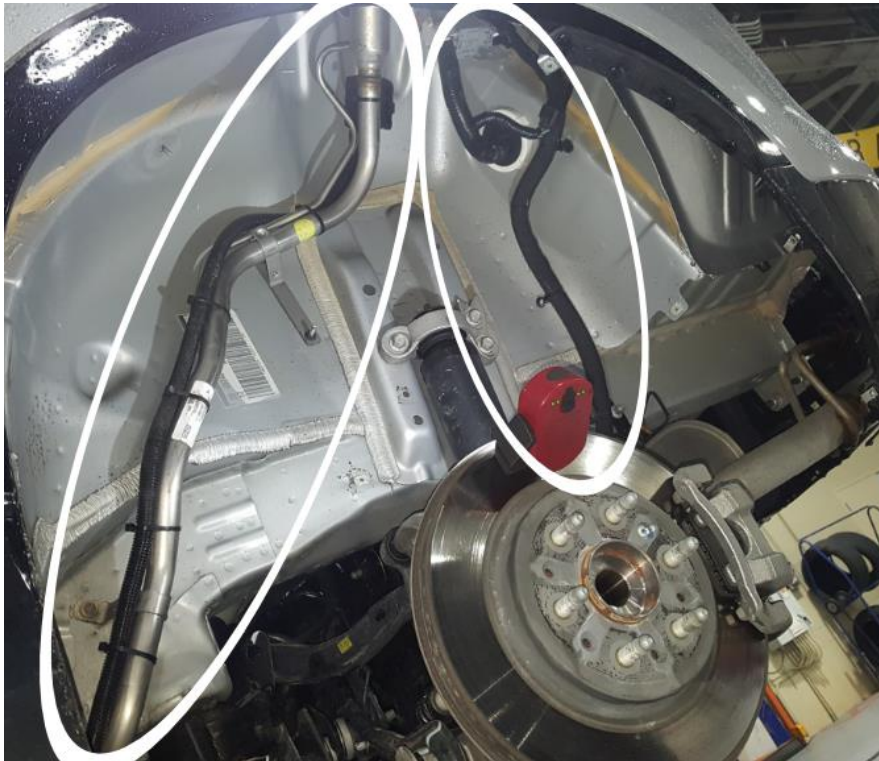

3. Inspect the fuel filler neck and wire harness circled above for any damage.
  - a. If damage is found, open a new warranty line and repair the components as necessary before proceeding to step 4.
  - b. If no damage is found, proceed directly to step 4.
4. Install the Left Rear Wheelhouse Liner. Refer to *Rear Wheelhouse Liner Replacement* in SI.
5. Reinstall the left rear wheel. Refer to *Tire and Wheel Removal and Installation* in SI.
6. Lower the vehicle.

GLOBAL SAFETY FIELD INVESTIGATIONS  
DCS6097  
URGENT - DISTRIBUTE IMMEDIATELY

Date: March 24, 2022

Subject: Update to Stop Delivery Order for N222363820 – Driver's Side Rear Wheel Liner – Instruction Sheet Attached

Models: 2022 Chevrolet Blazer

To: Select General Motors Dealers in Michigan and Ohio Only

Attn: Dealer Principal, Sales/Service/Parts Managers

On March 17, 2022, or March 21, 2022, we advised of the stop delivery of certain VINs for 2022 model year Chevrolet Blazer vehicles.

The attached Instructions document details important information regarding the required steps to complete the release of these vehicles from Stop Delivery. It also provides part information, transaction information (including labor code), and the service procedure.

It is a violation of federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by this notification until the defect is remedied.

Important: Parts will be shipped and are expected to arrive to your dealership in the next few days. Included in the box are the attached set of instructions and a note stating to which VIN the driver's side rear wheel liner needs to be installed.

Until all steps in the instruction document have been completed, these involved vehicles that are in your possession must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration purposes or any other dealer use.

Attached is a list of the involved BACs and the associated VINs.

The Investigate Vehicle History (IVH) screen in the Global Warranty Management (GWM) system will be updated with the new labor code on March 24, 2022. The following statement will be in IVH in the Description field: For Dealers that require a copy of the remedy instruction sheet please contact TAC and Reference AIT3464.

END OF MESSAGE  
GLOBAL SAFETY FIELD INVESTIGATIONS