



Thor Motor Coach Technical Service Bulletin

TSB #	TSB 22-03		
Description/Title:	Axis & Vegas emergency starting issue.		
Affected Product Line(s):	Certain model year 2022 Axis & Vegas motorhomes		
Service Campaign # :	RC000260	Released Date:	3/28/2022
Codes:	Inspect Only: TMCTS80274Y Inspect with Repair: TMCTS80274W	Document Date:	3/28/2022
Time Allowed:	Inspect Only: 0.1 Inspect with Repair: 0.2	Document Revision:	A

Issue:

Axis & Vegas emergency start harness issue. The two inline fuses are on the post with the chassis battery cable and they should be with the coach battery cable.

Tools Required:

- 13mm wrench or socket

Part(s) Required:

None

Instructions:

1. Inspect the unit to determine if the issue is present.

2. In the picture below, you can see the two 2 gauge cables, one going to the coach battery and one going to the chassis battery. The two inline holders should be connected to the post with the coach battery cable. The easiest way to check is to disconnect the coach battery cable at the battery itself and then use a test light to see which of these two posts is dead. The dead post is the

coach post, and the fuses should be connected there. An alternative would be to see if the dash radio still turns on when the coach battery is disconnected. If it does they're on the wrong post.

