

Newmar Corporation

PO Box 30
Nappanee, IN 46550



WHEN YOU KNOW THE DIFFERENCE.

RSB 575
March 25, 2022

NHTSA #22V 043
TC #2022-035

RECALL SERVICE BULLETIN

AFFECTED MODELS

2020 – 2022 :: Super Star, Supreme Aire

DESCRIPTION

Newmar Corporation has decided that a defect, which relates to motor vehicle safety exists in specific motorhomes built on Freightliner M2 chassis.

ISSUE

On certain motorhomes, the tire valve stem extension for the inner wheel may contact the outer wheel rim opening. This may potentially damage the valve stem extension and result in loss of air pressure in the inner tire. This could increase the risk of a crash.

UNITS AFFECTED

Please refer to the attached population list for affected units and VINs.

CORRECTIVE ACTION

Order the correct quantity of parts and follow the attached work instructions.

PARTS NEEDED

Unit Type	Item Description	Quantity	Newmar Part #
(SSCC)	Stabilizer 2.5"	2	153402
(SSCC)	Valve Stem 6"	2	160568
(SACC)	Stabilizer 2.5"	4	153402
(SACC)	Valve Stem 6"	4	160568

FLAT RATE CODE: 22V 043

LABOR TIME: .4 hr. per drive axle

Note: Super Star coaches have one drive axle, and Supreme Aire coaches have two drive axles.

DEALER ACTION

If you need assistance, contact your Newmar Service Account Manager.

IMPORTANT: Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.

NOTICE: Any technical information published in this bulletin is intended for use only by a qualified, Newmar-authorized service technician. Newmar is not responsible for the misuse of this information.



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

Date: 03/14/2022

Re: Newmar Corporation – Motor Vehicle Recall Notification

Subject: Recall Campaign No.: 22V-043

This notice is sent to you as a Newmar Dealer in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific Newmar recreational vehicles.

The National Traffic and Motor Vehicle Safety Act requires that each vehicle, which is subject to a recall campaign of this type, must be satisfactorily repaired within a reasonable time after the owner has tendered it for repair. A failure to adequately repair within 60 days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. To avoid providing these problematic solutions, every effort must be made to promptly schedule an appointment with each owner and to repair their vehicle as soon as possible. Vehicle owners are being notified of this recall. If the condition is not remedied within a reasonable time, they are instructed on how to contact the National Highway Traffic Safety Administration.

REASON FOR THIS RECALL

Newmar Corporation has decided that a defect which relates to motor vehicle safety exists in specific motorhomes built on Freightliner M2 Chassis.

On certain motorhomes built on a Freightliner M2 Chassis, a problem with the tire valve stem extension for the inner wheel contacting the outer wheel rim opening, potentially damaging the valve stem extension which could result in loss of air pressure in the inner tire. This could increase the risk of a crash.

Motorhomes included in this recall include 2020-2022 Super Star and Supreme Aire Class C units.

These motorhomes require immediate service. Continued use poses a potential safety hazard.

DEALER CAMPAIGN RESPONSIBILITY

Dealers are to provide to all customers/owner vehicles the service of completing this campaign at no charge to the customer/owner regardless of vehicle age, vehicle mileage, or ownership at the time of repair.

REPAIR PROCEDURE

Newmar Corp. will provide the work instructions.

If you should have any questions please contact your service account manager direct or the Newmar service department at: 1-866-290-5371.

Thank you for your cooperation.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

IMPORTANT SAFETY RECALL

This notice applies to your vehicle VIN. # _____

Name

Address

City, State Zip code

Date: 03/14/2022

Motor Vehicle Recall Notification - Recall Campaign No. 22V-043

Dear Valued Customer:

This notice is being sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

REASON FOR THIS RECALL

Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific motorhomes built on Freightliner M2 Chassis.

On certain motorhomes built on a Freightliner M2 Chassis, a problem with the tire valve stem extension for the inner wheel contacting the outer wheel rim opening, potentially damaging the valve stem extension, which could result in a loss of air pressure in the inner tire. This could increase the risk of a crash.

These motorhomes require immediate service. Continued use poses a potential safety hazard.

The Safety Risk

Damage to the inner wheel valve stem extension could result in a loss of air pressure in the inner tire. This could increase the risk of a crash.

WHAT WE WILL DO

Newmar Corp. will provide owners of all affected motorhomes a remedy for the potential defect at no charge for parts or labor. The inner valve stem extension will be inspected for damage and replaced with a new valve stem extension if damaged. All units will have a valve stem extension grommet/stabilizer installed to prevent the valve stem extension from contacting the outer wheel rim. The total expected time for repair is .4 hrs per axle. However, due to scheduling times the service provider may need the vehicle longer.

WHAT YOU NEED TO DO

As this defect does affect motor vehicle safety, it is recommended that you call Newmar service department immediately at **1-800-731-8300**. An associate will assist you in making an appointment to have this repair completed.

Federal regulations require that any vehicle lessor receiving this recall notification must forward a copy of this notice to the lessee within ten days.

If you have had the repair performed before receiving this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy. For additional information contact Newmar Corporation at:

Service Department
Newmar Corporation
355 N Delaware St
Nappanee, IN 46550-0030

Newmar dealers are best equipped to obtain parts and provide service to ensure your vehicle is corrected as promptly as possible. HOWEVER, if you take your vehicle to your dealer on the scheduled date and this condition is not remedied on that date or within five days; please contact the Newmar Corporation Customer Service Department at 1-800-731-8300. You may also submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave., SE., Washington DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.

If you no longer own this vehicle, please furnish us the complete name and address of the person or dealership you sold or traded your vehicle to. Thank you for your cooperation.

Your safety and satisfaction with your Newmar product is important to us and we regret any inconvenience to you.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

Date: 3/14/2022

Re: Newmar Corporation – Motor Vehicle Recall Notification

Subject: Recall Campaign No.: #2022-035

This notice is sent to you as a Newmar Dealer in accordance with the requirements of the *Canada Motor Vehicle Safety Act*. Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific Newmar recreational vehicles.

Each vehicle, which is subject to a recall campaign of this type, must be satisfactorily repaired within a reasonable time after the owner has tendered it for repair. A failure to adequately repair within 60 days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. To avoid providing these problematic solutions, every effort must be made to promptly schedule an appointment with each owner and to repair their vehicle as soon as possible. Vehicle owners are being notified of this recall. If the condition is not remedied within a reasonable time, they are instructed to contact Transport Canada.

REASON FOR THIS RECALL

Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific motorhomes built on Freightliner M2 Chassis.

Issue:

On certain motorhomes, the tire valve stem extensions for the inner wheels may get damaged by contact with the outer wheels. If this happens, the inner tire could lose air pressure. This could overload the outer tire and cause it to fail.

Safety Risk:

A tire failure could cause a loss of control and increase the risk of a crash.

Corrective Actions:

Newmar will notify owners by mail and instruct you to take your motorhome to a dealer to inspect the valve stem extensions for damage on the inner wheels, and replace them if required. The dealer will also install a valve stem extension grommet/stabilizer to prevent it from contacting the outer wheel rim.

This recall applies to certain Newmar 2020, 2021, 2022 Super Star Class C motorhomes, 2020 Supreme Aire Class C motorhomes.

The motorhomes require immediate service. Continued use poses a potential safety hazard.

DEALER CAMPAIGN RESPONSIBILITY

Dealers are to provide to all customers/owner vehicles the service of completing this campaign at no charge to the customer/owner regardless of vehicle age, vehicle mileage, or ownership at the time of repair.

REPAIR PROCEDURE

Newmar Corp. will provide the work instructions.

If you should have any questions please contact your service account manager direct or the Newmar service department at: 1-866-290-5371.

Thank you for your cooperation.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

VIN#
make, model, model year
Name
Address
City, State Zip code

Date: 3/16/2022
Motor Vehicle Recall Notification - Recall Campaign No. 2022-035

Dear Valued Customer:

This notice is sent to you in accordance with the requirements of the *Canada Motor Vehicle Safety Act*.

This is to inform you that your vehicle may contain a defect that could affect the safety of a person.

REASON FOR THIS RECALL

Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific motorhome built on Freightliner M2 Chassis.

Issue:

On certain motorhomes, the tire valve stem extensions for the inner wheels may get damaged by contact with the outer wheels. If this happens, the inner tire could lose air pressure. This could overload the outer tire and cause it to fail.

Safety Risk:

A tire failure could cause a loss of control and increase the risk of a crash.

Corrective Actions:

Newmar will notify owners by mail and instruct you to take your motorhome to a dealer to inspect the valve stem extensions for damage on the inner wheels, and replace them if required. The dealer will also install a valve stem extension grommet/stabilizer to prevent it from contacting the outer wheel rim.

The motorhomes require immediate service. Continued use poses a potential safety hazard.

WHAT WE WILL DO

Newmar Corp. will provide owners of all affected motorhomes a remedy for the potential defect at no charge for parts or labor. The inner valve stem extension will be inspected for damage and replaced with a new valve stem extension if damaged. All units will have a valve stem extension grommet/stabilizer installed to prevent the valve stem extension from contacting the outer wheel rim. The total expected time for repair is .4 hrs per axle. However, due to scheduling times the service provider may need the vehicle longer.

WHAT YOU NEED TO DO

As this defect does affect motor vehicle safety, it is recommended that you call Newmar service department immediately at **1-800-731-8300**. An associate will assist you in making an appointment to have this repair completed.

Federal regulations require that any vehicle lessor receiving this recall notification must forward a copy of this notice to the lessee within ten days.

If you have had the repair performed before receiving this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy. For additional information contact Newmar Corporation at:

Service Department
Newmar Corporation
355 N Delaware St
Nappanee, IN 46550-0030

Authorized Service Facilities, are best equipped to obtain parts and provide service to ensure your vehicle is corrected as promptly as possible. HOWEVER, if you take your vehicle to your Authorized Service Facility on the scheduled date and this condition is not remedied on that date or within five days; please contact the Newmar Corporation Customer Service Department at 1-800-731-8300.

If you no longer own this vehicle, please furnish us the complete name and address of the person or dealership you sold or traded your vehicle to. Thank you for your cooperation.

Your safety and satisfaction with your Newmar product is important to us and we regret any inconvenience to you.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

NIV
marque, modèle, année du modèle
Nom
Adresse
Ville, État, Code postal

Date : 21/03/2022

Avis de rappel de véhicule à moteur – N° de campagne de rappel 2022-035

Cher client,

Le présent avis vous est envoyé conformément aux exigences de la [Loi sur la sécurité automobile du Canada](#).

La présente a pour but de vous informer que votre véhicule est susceptible de présenter un défaut qui pourrait porter atteinte à la sécurité des personnes.

RAISON DE CE RAPPEL

Newmar Corporation a identifié un défaut, lié à la sécurité des véhicules à moteur, sur des véhicules récréatifs spécifiques construits sur des châssis Freightliner M2.

Problème :

Sur certains véhicules récréatifs, les extensions de tige de valve de pneu pour les roues intérieures pourraient être endommagées par le contact avec les roues extérieures. Le cas échéant, le pneu intérieur pourrait perdre de la pression d'air. Cela pourrait surcharger le pneu extérieur et provoquer sa crevaison.

Risque pour la sécurité :

Une crevaison de pneu pourrait entraîner une perte de contrôle et augmenter le risque d'accident.

Mesures correctives :

Newmar informera les propriétaires par courrier et vous demandera d'amener votre véhicule récréatif chez un concessionnaire qui inspectera les extensions de tige de valve afin de détecter tout dommage occasionné au niveau des roues intérieures et de les remplacer si nécessaire. Le concessionnaire installera également un œillet/stabilisateur d'extension de tige de valve pour l'empêcher d'entrer en contact avec la jante de la roue extérieure.

Une réparation immédiate des véhicules récréatifs est indispensable. Leur utilisation continue présente un danger potentiel pour la sécurité.

CE QUE NOUS ALLONS FAIRE

Newmar Corp. offrira aux propriétaires de tous les véhicules récréatifs concernés une réparation sans frais du défaut potentiel, pour les pièces ou la main-d'œuvre. L'extension de tige de valve intérieure sera inspectée pour détecter tout dommage et remplacée par une nouvelle extension de tige de valve, le cas échéant. Un œillet/stabilisateur d'extension de tige de valve sera systématiquement installé afin d'empêcher l'extension de tige de valve d'entrer en contact avec la jante de la roue extérieure. La réparation devrait durer au total 25 minutes par essieu. Cependant, en raison de certains horaires de service, le concessionnaire pourrait devoir conserver votre véhicule pendant une période plus longue.

CE QUE VOUS DEVEZ FAIRE

Ce défaut concerne la sécurité des véhicules à moteur. Il est recommandé de contacter immédiatement le service après-vente de Newmar au **1-800-731-8300**. Un associé vous aidera à prendre rendez-vous pour effectuer cette réparation.

Les réglementations fédérales exigent que tout loueur de véhicule qui reçoit cet avis de rappel transmette une copie de ce dernier au locataire dans les dix (10) jours.

Si vous avez fait effectuer la réparation avant de recevoir cette lettre, vous pourriez être admissible au remboursement des frais de réparation. Pour de plus amples renseignements, veuillez contacter Newmar Corporation à l'adresse suivante :

Service après-vente
Newmar Corporation
355 N Delaware St
Nappanee, IN 46550-0030

Un centre de service agréé s'avèrera le mieux équipé pour obtenir des pièces et veiller à ce que votre véhicule soit réparé le plus rapidement possible. CEPENDANT, si vous apportez votre véhicule à votre centre de service agréé à la date prévue et que le problème n'est pas corrigé à cette date ou dans les cinq jours; veuillez contacter le service après-vente de Newmar Corporation au 1-800-731-8300.

Si vous ne possédez plus ce véhicule, veuillez nous fournir le nom complet et l'adresse de la personne ou du concessionnaire à qui vous avez vendu ou avec qui vous avez échangé votre véhicule. Nous vous remercions de votre collaboration.

Votre sécurité et votre satisfaction sont importantes pour nous et nous nous excusons de la gêne occasionnée.

Cordialement,

Newmar Corporation

Valve Stem Extension and Stabilizer Work Instructions

Verify inner dual tire is inflated to the correct tire pressure. This will help identify if the tire pressure is low to start with and the pressure the customer has been maintaining in the tire. If concerning low or flat prior to starting the recall, identify the issue (i.e.: object puncturing a tire, other damage, etc.). If you believe the tire or valve stem in the rim has been leaking, the issue must be rectified before installing a new extension and stabilizer. Separate and prior authorization will need to be approved by Newmar for rectifying the issue (if warrantable). Foreign objects in the tire would be the customer's responsibility.

Take pictures of the original valve stem extension installed, then remove the valve stem extension. Be sure to note any damage to the valve stem or valve stem extension (with picture). Install the new valve stem extension.


Spray the valve stem and extension with soapy bubble solution, and check for leaks. Make sure no leaks are detected at the valve stem extension or the valve stem at the rim.

If no leaks are detected, install the rubber stabilizer by putting the valve stem extension through the center hole. Then push the stabilizer into the rim with the flat side toward the dish of the rim and away from the lug nuts.

Check for leaks. Shine a light and use a mirror, if needed, to make sure no leak developed during the installation of the stabilizer.

If the customer had aftermarket TPMS sensors installed on a Super Star coach on the valve stem extensions, reinstall them and use a jamb nut to lock them in place (if used), and spray the TPMS sensor with the bubble solution to ensure no leaks are present at the TPMS sensor.

Take pictures of new stabilizers and valve stem extensions installed.

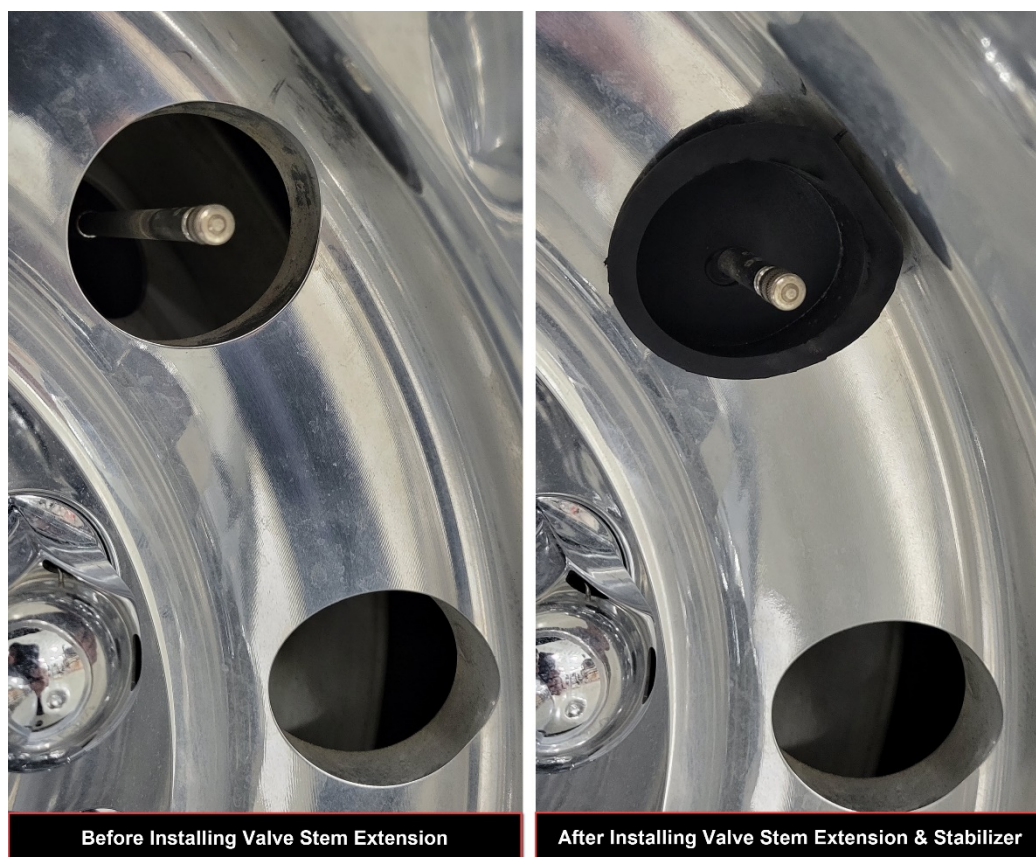

Submit before and after pictures when submitting the claim to Newmar.

Prod#	VIN Number	Year	Brand	Type	Floor	Chassis	Date In	Date Off
USA UNITS								
230101	3ALACYFE9KDKR9211	2020	SS	CC	4061	FS	1/18/2019	1/28/2019
230102	3ALACYFE5KDJM8382	2020	SS	CC	4061	FS	1/28/2019	2/6/2019
230103	1FVACYFE4LHLP3257	2020	SS	CC	4061	FS	7/12/2019	7/22/2019
230104	1FVACYFE7LHLP3284	2020	SS	CC	4061	FS	7/23/2019	7/31/2019
230105	1FVACYFE2LHLP3287	2020	SS	CC	4061	FS	9/25/2019	10/7/2019
230106	1FVACYFE4LHLP3260	2020	SS	CC	4061	FS	10/3/2019	10/14/2019
230107	1FVACYFE4LHLP3288	2020	SS	CC	4061	FS	10/10/2019	10/18/2019
230109	1FVACYFE8LHLP3262	2020	SS	CC	4061	FS	11/4/2019	11/14/2019
230110	1FVACYFE1MHMA9385	2020	SS	CC	4061	FS	3/24/2020	5/8/2020
230111	1FVACYFE6LHLP3258	2020	SS	CC	4061	FS	9/23/2019	10/3/2019
230112	1FVACYFE2LHLP3290	2020	SS	CC	4061	FS	11/6/2019	11/18/2019
230113	1FVACYFE8LHLP3259	2020	SS	CC	4061	FS	8/28/2019	9/6/2019
230114	1FVACYFE0LHLP3255	2020	SS	CC	4061	FS	7/9/2019	7/16/2019
230115	3ALACYFE4LDLP3281	2020	SS	CC	3746	FS	12/5/2019	12/13/2019
230116	3ALACYFE9LDLP3275	2020	SS	CC	3746	FS	8/22/2019	8/29/2019
230117	3ALACYFE5LDLP3273	2020	SS	CC	3746	FS	7/18/2019	7/26/2019
230118	3ALACYFE0LDLP3276	2020	SS	CC	3746	FS	9/5/2019	9/12/2019
230119	3ALACYFE7LDLP3274	2020	SS	CC	3746	FS	8/8/2019	8/16/2019
230120	3ALACYFE6LDLP3282	2020	SS	CC	3746	FS	10/29/2019	11/5/2019
230121	3ALACYFE6LDLP3279	2020	SS	CC	3746	FS	9/17/2019	9/24/2019
230122	3ALACYFE2LDLP3277	2020	SS	CC	3746	FS	10/17/2019	10/24/2019
230123	1FVACYFE1LHLP3250	2020	SS	CC	3746	FS	10/1/2019	10/9/2019
230124	3ALACYFE4LDMG5955	2020	SS	CC	3746	FS	2/26/2020	3/5/2020
230125	3ALACYFE2LDLP3280	2020	SS	CC	3746	FS	10/31/2019	11/12/2019
230126	3ALACYFE4LDLP3278	2020	SS	CC	3746	FS	11/14/2019	11/21/2019
230127	1FVACYFE5LHLP3283	2020	SS	CC	4051	FS	8/15/2019	8/22/2019
230128	1FVACYFE9LHLP3285	2020	SS	CC	4051	FS	9/3/2019	9/10/2019
230129	1FVACYFE3MHMA9386	2020	SS	CC	4051	FS	5/7/2020	5/15/2020
230130	1FVACYFEXLHLP3294	2020	SS	CC	4051	FS	2/17/2020	2/26/2020
230131	1FVACYFE0LHLP3286	2020	SS	CC	4051	FS	9/10/2019	9/18/2019
230132	1FVACYFE6LHLP3261	2020	SS	CC	4051	FS	10/23/2019	10/31/2019
230133	1FVACYFE2LHLP3256	2020	SS	CC	4051	FS	7/31/2019	8/8/2019
230134	1FVACYFE3LHLP3265	2020	SS	CC	4051	FS	12/3/2019	12/11/2019
230135	1FVACYFE9LHLP3271	2020	SS	CC	4051	FS	2/24/2020	3/3/2020
230136	1FVACYFE5MHMA9387	2020	SS	CC	4051	FS	5/13/2020	5/26/2020
230137	1FVACYFE6LHLP3289	2020	SS	CC	4061	FS	10/21/2019	10/29/2019
230138	1FVACYFE1LHLP3264	2020	SS	CC	4058	FS	11/26/2019	12/9/2019
230139	1FVACYFEXLHLP3263	2020	SS	CC	4061	FS	11/19/2019	11/27/2019
230140	1FVACYFE3LHLP3296	2021	SS	CC	4051	FS	1/9/2020	1/16/2020
230141	1FVACYFE4LHLP3291	2020	SS	CC	4058	FS	1/21/2020	1/30/2020
230142	3ALACYFE0LDMG5953	2020	SS	CC	4058	FS	3/13/2020	3/23/2020
230143	1FVACYFE6LHLP3292	2020	SS	CC	4058	FS	1/27/2020	2/4/2020
230144	1FVACYFE8LHLP3293	2020	SS	CC	4058	FS	2/10/2020	2/18/2020
230145	1FVACYFE1LHLP3295	2021	SS	CC	3746	FS	1/13/2020	1/21/2020
230148	1FVACYFE0LHLP3269	2020	SS	CC	4061	FS	2/28/2020	3/10/2020

Prod#	VIN Number	Year	Brand	Type	Floor	Chassis	Date In	Date Off
230150	3ALACYFE2LDMG5954	2020	SS	CC	4061	FS	3/17/2020	5/4/2020
230152	1FVACYFE7MHMA9388	2021	SS	CC	4051	FS	8/24/2020	9/2/2020
230153	1FVACYFE1MHMA9399	2021	SS	CC	3746	FS	9/22/2020	10/1/2020
230154	3ALACYFE8LDMG5957	2021	SS	CC	3746	FS	8/3/2020	8/11/2020
230155	1FVACYFE9MHMA9389	2021	SS	CC	4051	FS	8/28/2020	9/8/2020
230156	1FVACYFE0MHMA9393	2021	SS	CC	3746	FS	8/5/2020	8/17/2020
230159	3ALACYFE9LDMG5952	2021	SS	CC	4051	FL	8/11/2020	8/20/2020
230160	1FVACYFE6MHMA9396	2021	SS	CC	4051	FL	9/21/2020	9/30/2020
230161	1FVACYFE9MHMA9411	2021	SS	CC	4058	FS	11/18/2020	12/8/2020
230162	1FVACYFEXMHMA9398	2021	SS	CC	4058	FS	10/8/2020	10/16/2020
230163	1FVACYFE6MHMA9415	2021	SS	CC	4061	FS	1/13/2021	1/20/2021
230164	1FVACYFE2MHMA9394	2021	SS	CC	4061	FS	9/4/2020	9/15/2020
230165	1FVACYFE0MHMA9412	2021	SS	CC	4061	FS	11/16/2020	12/2/2020
230167	1FVACYFE7MHMA9410	2021	SS	CC	4058	FS	11/10/2020	11/30/2020
230168	1FVACYFE1MHMA9418	2021	SS	CC	3746	FS	12/7/2020	12/15/2020
230169	1FVACYFE4MHMA9395	2021	SS	CC	4051	FS	9/14/2020	9/22/2020
230170	1FVACYFE3MHMA9405	2021	SS	CC	4061	FS	10/23/2020	11/3/2020
230171	1FVACYFE2MHMA9413	2021	SS	CC	4061	FS	12/1/2020	12/11/2020
230174	1FVACYFE2MHMT2212	2021	SS	CC	4051	FS	1/26/2021	2/3/2021
230175	1FVACYFE4MHMA9414	2021	SS	CC	4061	FS	12/16/2020	1/11/2021
230176	1FVACYFE4MHMA9400	2021	SS	CC	3746	FS	10/15/2020	10/23/2020
230177	1FVACYFE1MHMA9404	2021	SS	CC	4061	FS	10/13/2020	10/21/2020
230178	1FVACYFE8MHMA9397	2021	SS	CC	4051	FS	9/28/2020	10/7/2020
230179	1FVACYFEXMHMA9417	2021	SS	CC	3746	FS	1/7/2021	1/15/2021
230180	1FVACYFE3MHMA9419	2021	SS	CC	3746	FS	1/20/2021	1/27/2021
230181	1FVACYFE5MHMA9406	2021	SS	CC	3746	FS	10/28/2020	11/6/2020
230182	1FVACYFE8MHMA9416	2021	SS	CC	4061	FS	1/5/2021	1/14/2021
230184	1FVACYFE0MHMA9409	2021	SS	CC	4061	FS	10/19/2020	10/27/2020
230186	1FVACYFE2MHMA9427	2021	SS	CC	3746	FS	4/15/2021	4/22/2021
230188	3ALACYFE0MDMY0202	2021	SS	CC	4061	FS	5/7/2021	5/17/2021
230190	1FVACYFE8MHMU9810	2021	SS	CC	4061	FS	3/8/2021	3/16/2021
230191	1FVACYFE0MHMT2211	2021	SS	CC	4058	FS	3/1/2021	3/9/2021
230192	1FVACYFE1MHMA9421	2021	SS	CC	4051	FS	2/9/2021	2/18/2021
230193	1FVACYFE1MHMU9809	2021	SS	CC	4051	FS	3/4/2021	3/12/2021
230194	1FVACYFE4MHMV0937	2021	SS	CC	4061	FS	3/9/2021	3/17/2021
230195	1FVACYFE0MHMA9426	2021	SS	CC	4051	FS	2/11/2021	2/22/2021
230196	1FVACYFE4MHMV0940	2021	SS	CC	4061	FS	4/7/2021	4/15/2021
230197	1FVACYFE9MHMT2210	2021	SS	CC	4061	FS	2/15/2021	2/24/2021
230198	1FVACYFEXMHMT2216	2021	SS	CC	4061	FS	3/10/2021	3/18/2021
230199	1FVACYFE3MHMA9422	2021	SS	CC	4051	FS	2/18/2021	3/2/2021
230201	1FVACYFE4MHMT2213	2021	SS	CC	3746	FL	4/20/2021	4/27/2021
230202	1FVACYFE9MHMT2207	2021	SS	CC	3746	FS	2/23/2021	3/5/2021
230204	1FVACYFEXMHR7843	2022	SS	CC	4059	FS	1/18/2021	1/25/2021
230206	3ALACYFE4MDMY0199	2021	SS	CC	3746	FS	5/11/2021	5/19/2021
230209	1FVACYFE8MHMT2215	2021	SS	CC	4051	FS	3/29/2021	4/8/2021
230210	1FVACYFE1MHR7844	2022	SS	CC	3727	FS	2/2/2021	2/10/2021

Prod#	VIN Number	Year	Brand	Type	Floor	Chassis	Date In	Date Off
230213	1FVACYFE2MHMT2209	2021	SS	CC	4061	FS	3/25/2021	4/6/2021
230214	1FVACYFE6MHMV0938	2021	SS	CC	4051	FS	3/23/2021	3/30/2021
230216	3ALACYFE9MDMY0201	2021	SS	CC	4051	FS	4/21/2021	4/29/2021
230217	3ALACYFE2MDMY0198	2021	SS	CC	3746	FS	4/27/2021	5/5/2021
230218	1FVACYFE8MHMV0939	2021	SS	CC	4061	FS	4/5/2021	4/13/2021
230219	1FVACYFE0MHMT2208	2021	SS	CC	3746	FL	5/18/2021	5/25/2021
230221	1FVACYFE6NHNC3531	2022	SS	CC	4059	FS	8/5/2021	8/17/2021
230222	1FVACYFE8NHNC3532	2022	SS	CC	4059	FS	7/30/2021	8/9/2021
230227	3ALACYFE7NDNH3991	2022	SS	CC	4059	FS	9/24/2021	10/5/2021
230229	3ALACYFE6NDNH3982	2022	SS	CC	4059	FS	10/20/2021	11/2/2021
230231	3ALACYFE7NDNH3988	2022	SS	CC	4061	FS	10/7/2021	10/20/2021
230233	1FVACYFE1NHNC3534	2022	SS	CC	4059	FS	9/9/2021	9/21/2021
230237	3ALACYFE4NDNH3995	2022	SS	CC	4065	FS	10/18/2021	10/27/2021
230239	1FVACYFE5NHNC3536	2022	SS	CC	4059	FS	9/15/2021	9/23/2021
230240	3ALACYFE3NDNH3986	2022	SS	CC	4065	FS	9/22/2021	9/30/2021
230248	1FVACYFE8NHNC3529	2022	SS	CC	4059	FS	7/1/2021	7/19/2021
230249	1FVACYFEXNHNC3547	2022	SS	CC	3727	FS	7/13/2021	7/21/2021
230250	3ALACYFE2NDNH3977	2022	SS	CC	3727	FS	9/1/2021	9/9/2021
230251	1FVACYFE4NHNC3530	2022	SS	CC	4061	FS	6/29/2021	7/14/2021
230252	1FVACYFE6NHNC3528	2022	SS	CC	4059	FS	6/21/2021	6/30/2021
230253	1FVACYFE8NHNC3546	2022	SS	CC	3727	FS	8/18/2021	8/30/2021
230261	3ALACYFE4NDNH3978	2022	SS	CC	3727	FS	9/21/2021	9/28/2021
230267	3ALACYFE2NDNH3994	2022	SS	CC	3727	FS	10/21/2021	11/3/2021
230272	3ALACYFE4NDNH3981	2022	SS	CC	4065	FS	9/17/2021	9/27/2021
230274	3ALACYFE2NDNH3980	2022	SS	CC	4059	FS	9/29/2021	10/11/2021
230275	3ALACYFE1NDNH3985	2022	SS	CC	4059	FS	9/28/2021	10/7/2021
230283	1FVACYFE1NHNC3548	2022	SS	CC	3727	FS	7/21/2021	7/29/2021
230294	1FVACYFE4NHNC3527	2022	SS	CC	4059	FS	8/3/2021	8/10/2021
230313	3ALACYFE8NDNH3983	2022	SS	CC	4059	FS	8/27/2021	9/7/2021
230329	1FVACYFEXNHNC3533	2022	SS	CC	4065	FS	10/13/2021	10/25/2021
230337	3ALACYFE9NDNH3992	2022	SS	CC	4059	FS	10/27/2021	11/8/2021
230340	3ALACYFEXNDNH3998	2022	SS	CC	4059	FS	11/18/2021	12/1/2021
230342	3ALACYFEXNDNH3984	2022	SS	CC	3727	FS	9/2/2021	9/14/2021
230343	3ALACYFE6NDNH3979	2022	SS	CC	3727	FS	9/27/2021	10/6/2021
270101	3ALHC5DV5KDLG8908	2020	SA	CC	4573	FS	6/11/2019	6/20/2019
270102	3ALHC5DV2LDLP2663	2020	SA	CC	4573	FS	6/25/2019	7/10/2019
270103	3ALHC5DV4LDLP3247	2020	SA	CC	4573	FS	8/6/2019	8/13/2019
270104	1FVHC5DV3LHLP3251	2020	SA	CC	4573	FS	9/19/2019	9/30/2019
270105	3ALHC5DV8LDLP3249	2020	SA	CC	4573	FS	9/6/2019	9/17/2019
270106	1FVHC5DV0LHLP3272	2020	SA	CC	4573	FS	3/11/2020	3/19/2020
270108	1FVHC5DV7LHLP3267	2020	SA	CC	4573	FS	11/21/2019	12/4/2019
270109	3ALHC5DV2LDLP3246	2020	SA	CC	4573	FS	7/25/2019	8/5/2019
270112	3ALHC5DV6LDLP3248	2020	SA	CC	4573	FS	8/20/2019	8/28/2019
270113	1FVHC5DV5LHLP3297	2020	SA	CC	4573	FS	1/29/2020	2/6/2020
270114	1FVHC5DV7LHLP3298	2020	SA	CC	4573	FS	2/12/2020	2/20/2020
270115	1FVHC5DV7LHLP3270	2021	SA	CC	4575	FS	12/19/2019	1/14/2020

Prod#	VIN Number	Year	Brand	Type	Floor	Chassis	Date In	Date Off
270116	1FVHC5DV5LHLP3252	2021	SA	CC	4051	FS	2/4/2020	2/12/2020
270117	1FVHC5DV6MHMA9401	2021	SA	CC	4051	FS	7/27/2020	8/4/2020
270118	1FVHC5DV5JHJN7169	2021	SA	CC	4051	FS	12/14/2020	1/7/2021
270119	1FVHC5DV9LHLP3299	2021	SA	CC	4573	FS	8/20/2020	8/28/2020
270120	1FVHC5DV7MHMA9391	2021	SA	CC	4573	FS	9/16/2020	9/24/2020
270122	1FVHC5DV8MHMA9402	2021	SA	CC	4575	FS	10/6/2020	10/14/2020
270123	1FVHC5DVXMHMA9403	2021	SA	CC	4573	FS	11/3/2020	11/12/2020
270124	1FVHC5DV9MHMA9392	2021	SA	CC	4573	FS	10/1/2020	10/19/2020
270125	1FVHC5DV7MHMA9424	2021	SA	CC	4051	FS	1/11/2021	1/18/2021
270126	1FVHC5DV2MHMR7836	2022	SA	CC	4573	FS	3/4/2021	3/12/2021
270127	1FVHC5DV9MHMA9408	2021	SA	CC	4573	FS	5/20/2021	5/28/2021
270128	3ALHC5DV1MDMY2105	2021	SA	CC	4061	FS	6/9/2021	6/17/2021
270129	1FVHC5DV5MHMA9423	2021	SA	CC	4051	FS	5/14/2021	5/21/2021
270130	1FVHC5DV7MHMA9407	2021	SA	CC	4573	FS	5/5/2021	5/14/2021
270131	1FVHC5DV4MHMR7837	2022	SA	CC	4590	FS	3/3/2021	3/11/2021
270132	3ALHC5DV3MDMY2106	2021	SA	CC	4051	FS	6/3/2021	6/10/2021
270138	1FVHC5DV9MHMA9425	2022	SA	CC	4573	FS	7/16/2021	7/26/2021
270142	1FVHC5DVXNHNC3564	2022	SA	CC	4573	FS	7/23/2021	8/2/2021
270144	3ALHC5DV5NDNH3987	2022	SA	CC	4061	FS	9/10/2021	9/22/2021
270146	3ALHC5DV1NDNH4005	2022	SA	CC	4051	FS	10/26/2021	11/5/2021
270148	1FVHC5DV3NHNC3566	2022	SA	CC	4573	FS	7/27/2021	8/4/2021
270161	1FVHC5DV8NHNC3563	2022	SA	CC	4051	FS	8/10/2021	8/24/2021
270168	3ALHC5DV9NDNH3989	2022	SA	CC	4575	FS	9/30/2021	10/12/2021
270169	1FVHC5DV1NHNC3565	2022	SA	CC	4573	FS	8/25/2021	9/2/2021
270174	3ALHC5DV8NDNH3997	2022	SA	CC	4573	FS	11/8/2021	11/16/2021

CANADIAN UNITS

230147	1FVACYFE9LHLP3268	2020	SS	CC	4061	FS	3/3/2020	3/12/2020
230157	3ALACYFE6LDMG5956	2021	SS	CC	3746	FS	6/19/2020	7/15/2020
230158	1FVACYFE6MHMT2214	2021	SS	CC	4061	FS	3/15/2021	3/23/2021
230166	3ALACYFE0MDMY0197	2021	SS	CC	3746	FS	4/29/2021	5/7/2021
230172	1FVACYFEXMHMA9420	2021	SS	CC	3746	FS	1/22/2021	2/1/2021
230200	3ALACYFE9MDMY0196	2021	SS	CC	3746	FS	3/18/2021	3/26/2021
230203	3ALACYFE7MDMY0200	2021	SS	CC	4061	FS	4/13/2021	4/20/2021
230268	1FVACYFE3NHNC3535	2022	SS	CC	4059	FS	9/8/2021	9/16/2021
230273	3ALACYFE5NDNH3990	2022	SS	CC	3727	FS	10/12/2021	10/21/2021
230276	3ALACYFE0NDNH3993	2022	SS	CC	3727	FS	10/14/2021	10/26/2021
270107	1FVHC5DV5LHLP3266	2020	SA	CC	4573	FS	10/15/2019	10/22/2019