



Service Bulletin

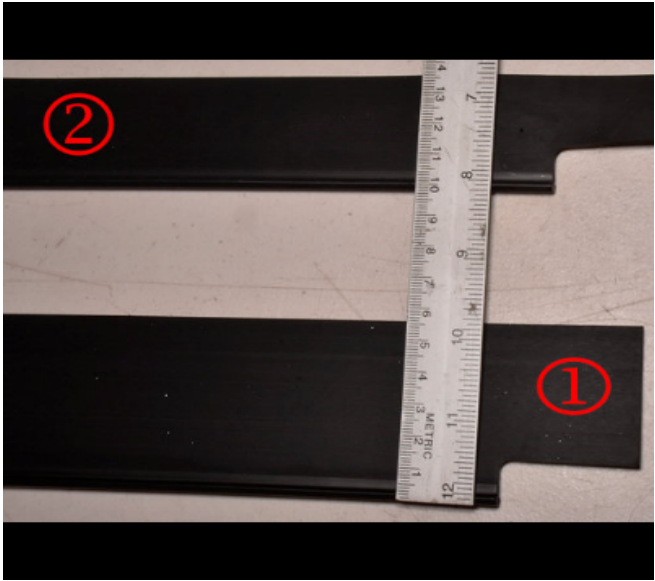
Bulletin No.: 22-NA-029

Date: March, 2022

TECHNICAL

Subject: Poorly Fitted Tonneau Cover at the Front Edge of the Box Exposing Trim that Should be Covered

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 1500	2021	2021	—	—	—	—
	Silverado 1500 LTD (RPO J21, 12th VIN Digit = 4 or less)	2022	2022				
GMC	Sierra 1500	2021	2021				
	Sierra 1500 Limited (RPO J21, 12th VIN Digit = 4 or less)	2022	2022				

Involved Region or Country	North America, Australia, New Zealand
Additional Options (RPOs)	Equipped with ACCESSORY-TONNEAU - RR COMPT - VINYL W/ INTEGRAL CROSSBOW SUPPORTS (RPO VPB)
Condition	Some customers may comment on their poorly fitted tonneau cover at the front edge of the box exposing the trim that should be covered.
Cause	This condition may be due to the tonneau cover becomes too tight and pulls the front rail rearward when the tonneau cover is closed exposing the trim, as shown in the video above.
Correction	<div style="text-align: center;">  </div> <p style="text-align: right; font-size: small;">5956093</p> <p>Install the revised seal (1) that is 19 mm wider than the current seal (2), as shown in the picture above.</p>

Service Procedure

Remove the tonneau and install the revised seal and reinstall the cover. Refer to *Pickup Box Folding Top Cover Package Installation* in SI.

Parts Information

Causal Part	Description	Part Number	Qty
X	Seal	86805609	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
0588628*	Replace Tonneau Cover Front Edge Seal	0.4 hrs.
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	Released March 09, 2022

