

SSM 50621 - 2022 Edge/Nautilus - Driver Seat Switch Inoperative With DTC B14D0 And B14CE - Built On Or Before 14-Mar-2022

Some 2022 Edge/Nautilus vehicles built on or before 14-Mar-2022 may exhibit a driver seat switch inoperative with diagnostic trouble codes (DTC) B14CE and B14D0 stored in the driver seat module (DSM). This may be due to a spread terminal. To correct this condition, inspect terminals 1,2,5, and 6 of connector C341F for possible terminal spread using a flex probe kit. If there is damaged detected, refer to Cell 005 of the Wiring Diagram and Workshop Manual (WSM), Section 100-00 General Information > Wire Terminal Inspection and Removal for inspection and repair procedures.

APPLICABLE VEHICLES
2022 CAR: DQ CD539N EDGE
2022 CAR: D9 U540N MKX