



GROUP	MODEL
BOD	2022MY Stinger (CK)
NUMBER	DATE
302 (Rev 1, 03/04/2022)	August 2021

TECHNICAL SERVICE BULLETIN

SERVICE ACTION: FRONT DOOR TRIM GRIP HANDLE REPAIR (SA483)

SUBJECT:

NOTICE

This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.

This bulletin provides information to repair the two (2) (LHS & RHS) front door trim grip handles on some 2022MY Stinger (CK) vehicles produced from February 25, 2021 through June 17, 2021, which may have the grip handle detached from the inside door trim. Follow the procedure outlined in this publication to repair the front door trim grip handles by replacing the door inside handle bracket screws as outlined in the inspection. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.



Door Trim Grip Handle (Left)

NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.

This issue number is SA483.

Replacement Procedure (Grip Handle Screws):

1. Remove the front door trim (A) by referring to the "Body (Interior and Exterior) → Front Door → Front Door Trim → Repair procedures" in the applicable Shop Manual on KGIS.

NOTICE


Use a non-marring trim removal tool (such as Snap-on® Part Number PBN5 or equivalent) to avoid damaging trim pieces.




2. Carefully separate the soundproofing felt (B) from the door trim panel starting from the two (2) areas shown.

CAUTION

Place door trim on an anti-scratch pad/surface. Be careful NOT to tear the soundproofing felt (B). Damage to either part will require replacement.

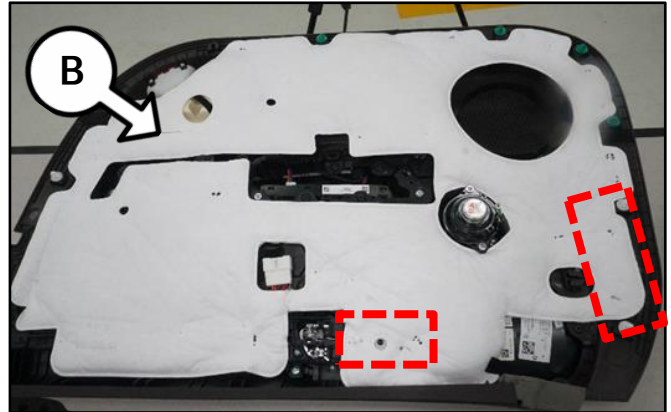

3. Lift the soundproofing felt (B) over to access the inside door handle grip mounting bracket (C).

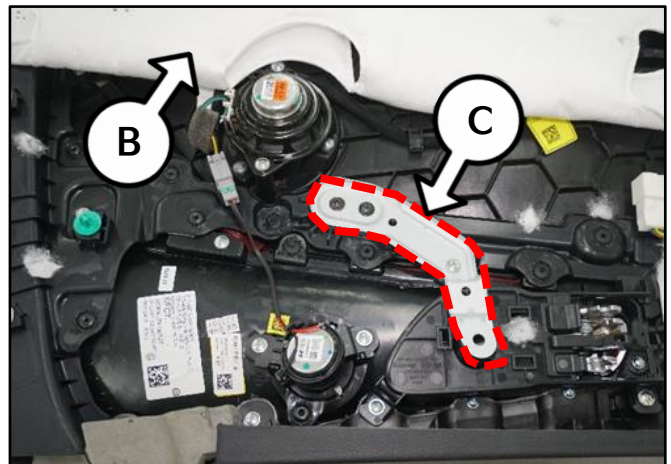

SUBJECT:

SERVICE ACTION: FRONT DOOR TRIM GRIP HANDLE REPAIR (SA483)

- 4a. Press down on the mounting bracket (C) with one hand as shown.
- 4b. Loosen the outside screw (D) first and install the new longer screw while pressing down.

Continue pressing down on the mounting bracket (C) with one hand as shown.



Loosen the inner screw (E) second and install the new longer screw(s) while pressing down.

ⓘ IMPORTANT

Ensure the door trim is on a flat surface. Replace the two (2) screws in the suggested order (D) 1st. & (E) 2nd.




Tightening torque for screw(s):
26.5 - 33.0 lb.ft (12 - 15 kgf.m)
DO NOT OVERTIGHTEN

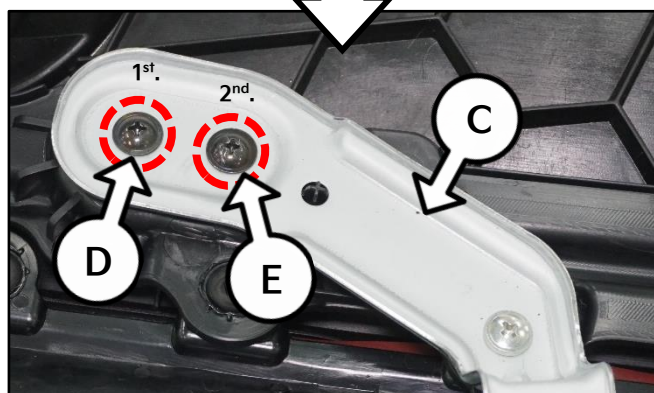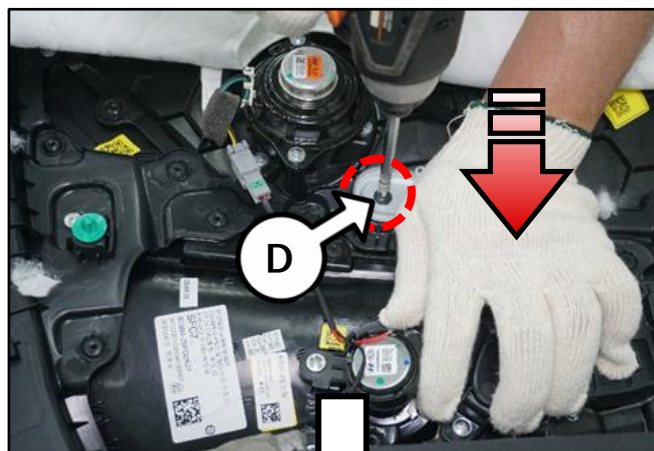

5. Confirm that the grip handle is secured tight by pulling on the handle.



6. Attach the soundproofing felt using the supplied non-woven fabric pads (F) on the edges as shown.

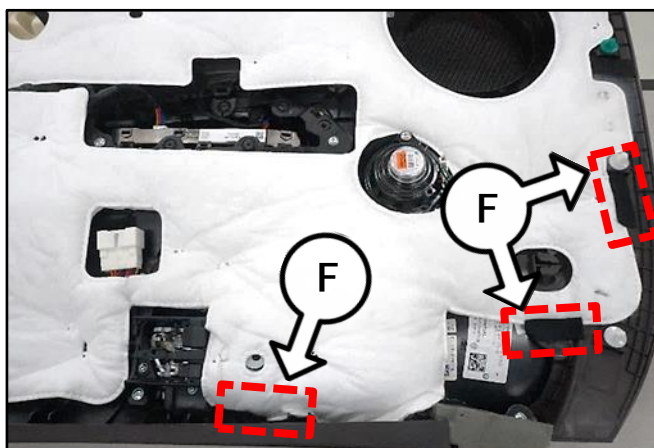

7. Reassemble the front door trim in the reverse order of disassembly.

SUBJECT:

SERVICE ACTION: FRONT DOOR TRIM GRIP HANDLE REPAIR (SA483)**AFFECTED VEHICLE RANGE:**

Model	Production Date Range
Stinger (CK)	February 25, 2021 to June 17, 2021

REQUIRED PART:

Part Name	Part Number	Figure	Qty.
Front Door Trim Repair Kit	82397 J5100QQK	 <p>Kit Contents: - Fastener (White): 8 each - Fastener (Green): 14 each - Washer: 4 each - T/Screw-Flange Head: 4 each - Non-Woven Fabric: 8 each</p>	1

Note: One (1) front door trim repair kit will service two (2) front doors.

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	82307 J5510CCM	0	(SA483) Front Door Panel Screw(s) Replacement (Both Sides)	210096R4	0.5 M/H	82397 J5100QQK	1

***Use the applicable Door Trim Panel Assy part number by referring to the Parts Table on page 5.**

Note: When necessary, manually enter sublet code 'X2' for reimbursement of one roundtrip rideshare expense or up to three (3) day rental maximum and attach supporting documentation.

NOTICE

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference **SA483** when accessing the WebDCS system.