



# Technical Service Bulletin

---

## 27 Vehicle electrical system warning, DTC P0A1E00 and/or P10F300 is stored in the starter/generator control module

27 22 44 2064534/2 March 30, 2022. Supersedes Technical Service Bulletin Group 27 number 21-38 dated September 14, 2021, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q3	2020 – 2022	All	MHEV

## Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Updated header (added MY 2022)
1	09/14/2021	Initial publication

### Customer states:

- The warning message, "Electrical system: fault. Please contact workshop" is displayed in the instrument cluster.

### Workshop findings:

One or more of the following DTCs are stored in the starter/generator control module, C29 (address word 00CC):

- DTC P0A1E00 (Starter/Generator Control Module) with symptom code 41543 or 38850.  
and/or
- DTC P10F300 (Starter generator Release status implausible).

## Technical Background

The software for the starter/generator control module, C29 (address word 00CC) needs to be updated.

## Production Solution

New software in the starter/generator control module, C29 (address word 00CC) addressed the condition.



# Technical Service Bulletin

---

## Service

### SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions.*
2. Update starter/generator control module, C29 (address word 00CC) using the SVM action code as listed in the table below, if necessary:

Model	Diagnostic Address	Old Software Part Number	Old Software Version	New Software Version (or higher)	SVM Code Input
Q3	00CC	05E903018F	0121	0123	CCA002
			0122		

## Warranty

Claim Type:	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• G10 for CPO Covered Vehicles – Verify Owner.</li><li>• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>			
Service Number:	2722			
Damage Code:	0039			
Labor Operations:	Software Update (Includes checking for DTCs)	0151 0000	Time stated on the diagnostic protocol (Max 100 TU)	
Diagnostic Time:	GFF	No allowance	0 TU	



# Technical Service Bulletin

---

	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB 2064534/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732: *00 Software Version Management (SVM), operating instructions*.

All part and service references provided in this TSB (**2064534**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.