

40 Clicking noise from wheel bearing

40 22 37 2024318/11 March 29, 2022. Supersedes Technical Service Bulletin Group 40 number 21-31 dated December 23, 2021, for reasons listed below.

© 2022 Audi of America, Inc.

Page 1 of 6

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prin expressed written permission of the publisher.



Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, and A7	2007 – 2017		
A6 Avant, and S6	2007 – 2011		
S8	2007 – 2009		
A5, and S5	2008 - 2023		
A4	2009 - 2023		
A4 Avant	2009 - 2012		
Q5	2009 2022		
A5 Cabriolet, and S5 Cabriolet	2010 – 2023		
S4	2010 - 2016		
A7	2012 - 2017		
A4 allroad, and Q5 Hybrid	2013 – 2016	Not Applicable	Not Applicable
S6, S7, and S8	2013 – 2017		
RS 5 and RS 5 Cabriolet	2013 – 2015		
SQ5	2014 – 2023		
RS 7	2014 - 2017		
A4 allroad, and Q7	2017 – 2023		
S4, A5 Sportback, and S5 Sportback	2018 – 2023		
RS 5	2018 – 2019		
Q8	2019 – 2023		
RS 5 Sportback	2019		

Page 2 of 6

© 2022 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Condition

REVISION HISTORY					
Revision	Date	Purpose			
11	-	Revised Parts and Tools (Updated Quantity)			
10	12/09/2021	Revised header (Added Model Year)			
9	05/13/2020	Revise header (Added Models and Model Years) Revised <i>Warranty</i> (Updated Labor Operation TU)			

Customer states:

Clicking or clacking noise when maneuvering or parking.

Technical Background

Microscopic movements between the wheel bearing and the wheel bearing housing may cause the noise (front left and/or the front right bearing can be affected).

Production Solution

Not applicable.

Service

^{© 2022} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



- 1. On the affected side(s), remove any corrosion and dirt from the wheel bearing housing and the wheel bearing.
- Using a brush, apply a thin coat of paste part number G 052109A2, using about .21 ounces or 6 grams (roughly 1/20) from the tube on the wheel bearing housing as shown (Figure 1). Make sure not to apply any paste on the threads.



Figure 1. Area to apply the paste.

Tip: Wheel bearings replaced for this concern will not be reimbursed under warranty.

Claim Type:	 110 up to 48 Months/50,000 Miles. G10 for CPO Covered Vehicles – Verify Owner. If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. 	
Service Number:	4057	
Damage Code:	0010	
Labor Operations:	All Vehicles	

Warranty

^{© 2022} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



	Modify wheel bearing(s)	4057 4999	10 TU	
	1 Wheel Hub Repaired			
	Wheel hub with bearing remove + reinstall	4057 19XX	See SRT	
	2 Wheel Hubs Repaired			
	2 Wheel hub with bearing remove + reinstall	4057 20XX	See SRT	
Diagnostic Time:	GFF	No Allowance	0 TU	
	Road test prior to service procedure	0121 0002	10 TU	
	Road test after service procedure	0121 0004	10 TU	
Claim Comment:	As per TSB 2024318/11			

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual.* Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.					
Part Number	Part Description	Quantity			
G 052109A2	Assembly paste	0.1			
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA			

© 2022 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prin expressed written permission of the publisher.



Additional Information

All parts and service references provided in this TSB (2024318) are subject to change and/or removal.

©2022 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.

^{© 2022} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.