

Subject:

MAZDA CONNECT AND/OR MYMAZDA APP DISPLAYS INCORRECT TIRE PRESSURES AFTER BATTERY DISCONNECT OR INFOTAINMENT SYSTEM SOFTWARE UPDATE

Service Alert No.: SA-012/22

Last Issued : 03/15/2022

BULLETIN NOTES

This Service Alert supersedes the previously issued bulletin(s) listed below. The changes are noted in Red text.

Previous Service Alerts:	Date(s) Issued:
SA-002/21	01/13/22
SA-044/20	04/02/20

APPLICABLE MODEL(S)/VINS

2019-2022 Mazda3 2020-2022 CX-30 2023 CX-50 2022 MX-30

DESCRIPTION

Some customers may complain about the infotainment system and/or the MyMazda App showing incorrect tire pressures and/or tire pressure missing.

This may be caused by:

- Incorrect calendar entry (month/day/year) after a battery disconnect
- · Infotainment system software update.
- BCM TPMS unlearn during vehicle storage or transport.
- Wheel/Tire change

MAZDA CONNECT		
	12:00 am	
	Maintenance Details Tre Pressure Monitoring	
	Distance Until Oil Change 7600 mil Updated Update	
	Next Service -11 Distance 5741 mil 38 38	
	26 🚺 38	
	(psi)	
	Drive vehicle to obtain the pressure data.	
	Incorrect Tire Pressure shown	

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "doit-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

© 2022 Mazda North American Operations, U.S.A.

	Maintenance Details Tire Pressure Monitoring Distance Until Oil Change 7600 mil Next Service -/-/ Distance 5741 mil Distance Trice -/-/ Distance 5741 mil Tire Pressure not shown
MyMazda App	B-30 III P VIHICLE STATUS III P III P III P

REPAIR PROCEDURE

Inspection / Action	Repair
 PDI inspection Battery disconnect/	 Enable GPS Time Synchronization. This will automatically synchronize the
reconnect Infotainment CMU	calendar using the GPS location data. a. Go to Main Menu -> Settings -> System Settings -> Clock -> GPS Time
software update	Synchronization -> Enable. b. Set Time Zone.

Page 2 of 3

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "doit-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

© 2022 Mazda North American Operations, U.S.A.

Last Issued : 03/15/2022

	2. Drive vehicle with a clear view of sky at 16 mph (25 km/h) or faster for 3 minutes or longer.
 Wheel/Tire change (such as installing winter tires) 	 Ignition ON Ignition OFF Let vehicle sit for 19 minutes or more. Ignition ON, engine running. Drive the vehicle at 16 mph (25 km/h) or faster for 3 minutes or longer. Confirm TPMS light is OFF

Page 3 of 3

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "doit-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

© 2022 Mazda North American Operations, U.S.A.