

## Staining/discoloration on chrome door/window trim



---

Topic number	LI72.00-P-074481
Version	1
Function group	72.00 - General
Date	3/3/22
Validity	Model 118
Reason for change	

---

### Complaint

Staining at top and bottom of trim bars of doors. See example pictures 1, 2.

Attachments	
File	Description
<a href="#">Bild 1.JPG</a> 	Overview of affected component parts
<a href="#">Bild 2.jpg</a> 	Example of complaint relating to door upper trim strip in silver look

# XENTRY TIPS

## Cause

Discoloration of the protective coating of beltline door trim bars and upper door trim bars due to strong alkaline detergent in car washes.

## Remedy

1. Polish the trim bars with polish A 000 986 43 74.
2. If the complaint cannot be rectified by polishing, replace the door beltline trim bars, door upper trim bars and rear side window with trim element with the optimized parts listed in this document.

WIS-References		
Document number	Title	Note
AR72.10-p-1610MFC	Remove/install sealing rail	

Symptoms
Body > Door/Flap > Door > Trim > Surface damage

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A1187200302			OUTER LEFT SEALING RAIL REAR DOOR	1	Valid for model 118	X
A1187200402			OUTER RIGHT SEALING RAIL REAR DOOR	1	Valid for model 118	X
A1187300701			OUTER LEFT SEALING RAIL REAR DOOR	1	Valid for model 118	X
A1187300801			OUTER LEFT SEALING RAIL REAR DOOR	1	Valid for model 118	X
A1186733100			TRIM STRIP, LEFT ROOF FRAME	1	Valid for model 118.6	X
A1186733200			TRIM STRIP, RIGHT ROOF FRAME	1	Valid for model 118.6	X
A1186732700			TRIM STRIP, LEFT ROOF FRAME	1	Valid for model 118.3	X
A1186732800			TRIM STRIP, RIGHT ROOF FRAME	1	Valid for model 118.3	X

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			72A4647	
			72N4647	
			73A4047	
			73N4047	
			69A3047	
			69N3047	