

Model Series 230: Airscarf Nonfunctional.


Topic number	LI91.29-P-059366
Version	3
Function group	91.29 - Seats - electrical system
Date	1/6/22
Validity	Model series 230 with SA code 403 (AIRSCARF system)
Reason for change	Change to part number of cable tie (project Focus)

Complaint

Airscarf nonfunctional, fuse may have triggered.

Cause

The electrical wiring harness is trapped between the height adjustment gearing and the cushion frame.

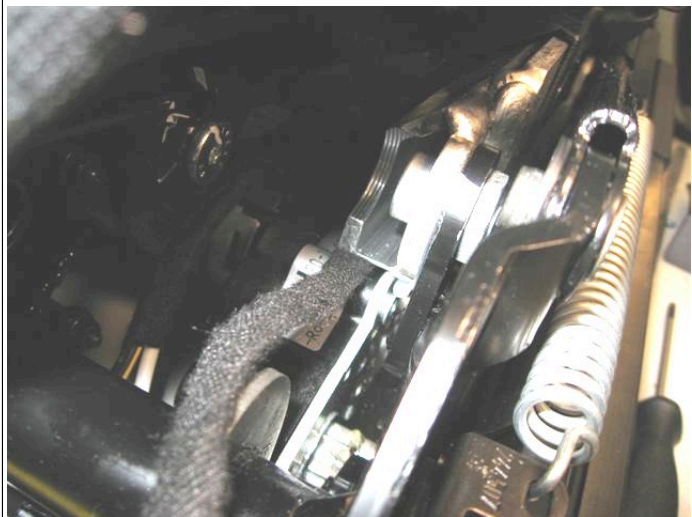Attachments	
File	Description
Sitz 004 _Small_.jpg	Damage profile
	

Remedy


Check the electrical wiring harness for damage (see Seat 004 _Small_.jpg) and repair if necessary.

Then secure the electrical wiring harness using additional cable ties (see Remedy.jpg).

Attachments	
File	Description

XENTRY TIPS

[Abhilfe.jpg](#)

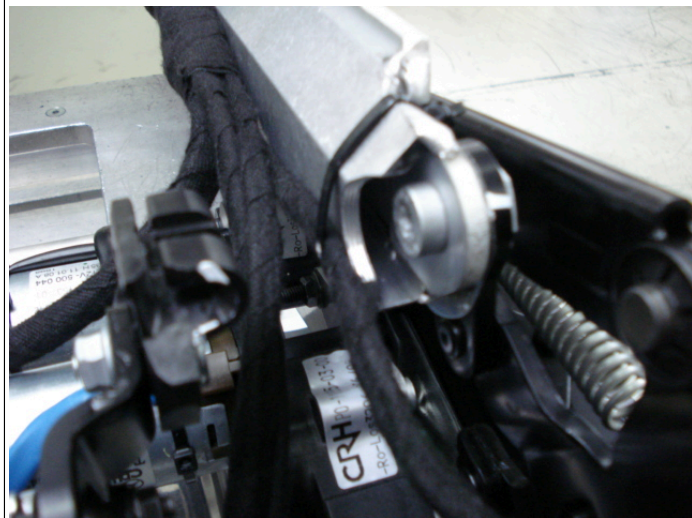

Remedy for attachment of wiring harness using cable ties

WIS-References

Document number	Title	Note
ar00.19-p-0001a	Repair wiring harness	

Symptoms

Body > Seat > AIRSCARF > Malfunction, blower

Body > Seat > AIRSCARF > Heater nonfunctional

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A0039973551			Protective hose	1	Length as required	X
A0949975903			Cable tie	1		X

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note