



WARRANTY BULLETIN WARRANTY CAMPAIGN

Can-Am® On-Road Spyder™

CAUTION: All involved customers must be notified, all involved units must be corrected as per instruction herein.


Campaign no.: 2022-0005

March 31, 2022

Subject: **Spyder RT - LH Side Panel and Driver's
Seat Gap Correction**

No. **2022-3**

MODEL YEAR	MODEL	ADMISSIBLE UNITS
2022	Spyder RT	Go to BOSSWeb/Warranty/Campaign Monitoring to know the quantity of units in your inventory impacted by this campaign
IMPORTANT - When a vehicle comes in for service, always type the VIN in Knowledge Center to check for pending campaigns or alerts. - When performing any work on a vehicle, it is good practice to connect it to BUDS2 to ensure that all needed updates are done.		

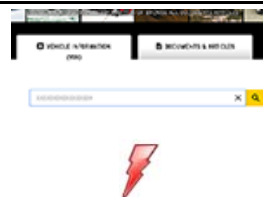

PROBLEM


Some RT vehicles present a gap between the LH side panel and the driver's seat.

SOLUTION

With the help of an adapter, enlarge the LH side panel fixation hole, pull up the panel and adjust the panel to reduce the gap.

PARTS REQUIRED

Please order part through regular channel.

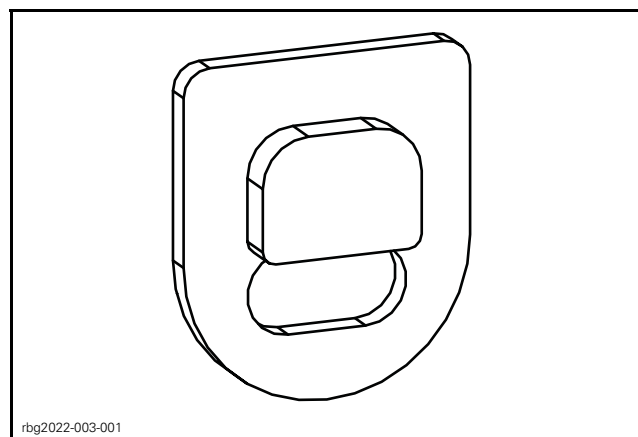


DESCRIPTION	PART NUMBER	QUANTITY
Adapter	705017687	1

CORRECTIVE ACTION


The enlargement of the LH side panel fixation hole is needed so an adjustment can be done to reduce the gap between the LH side panel and the driver's seat.

NOTE: Steps 1 through 4 are part of the *SPYDER RT PRE-DELIVERY BULLETIN 2022-3* procedure.


1. Remove the 2 locking ties then remove the windshield and the 2 polyfoam protective sheets.

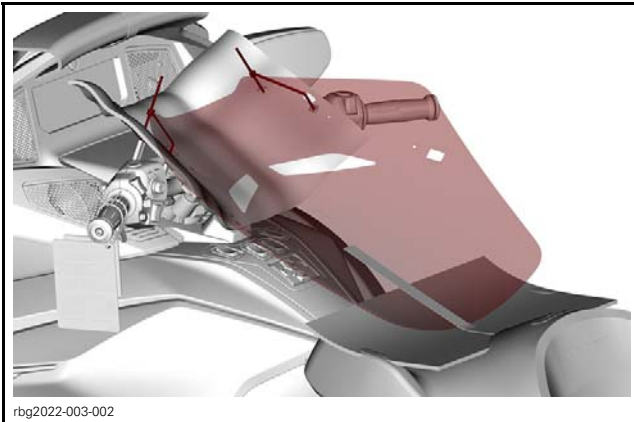


2. Remove the 2 M8 screws and remove the passenger seat with bracket.

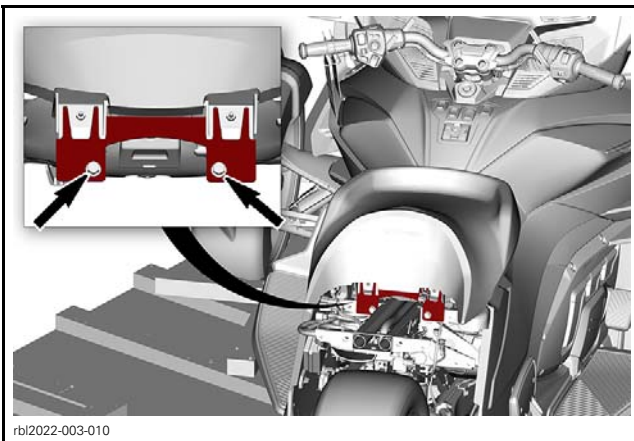


3. Remove and discard the seat bracket from the passenger's seat.

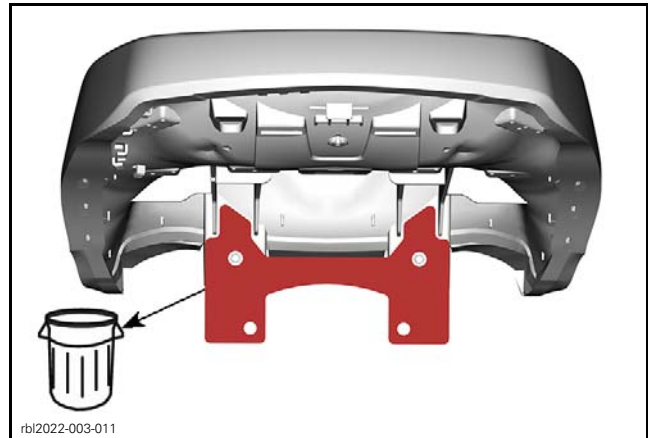


4. Cut the locking tie retaining the driver's seat arm to its shock absorber.

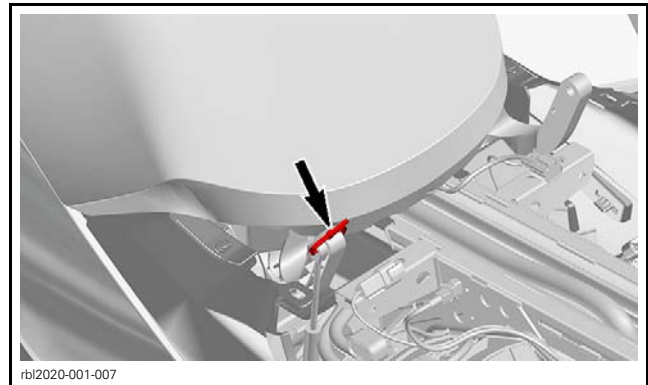


5. Disconnect the driver's seat connector then remove the seat.

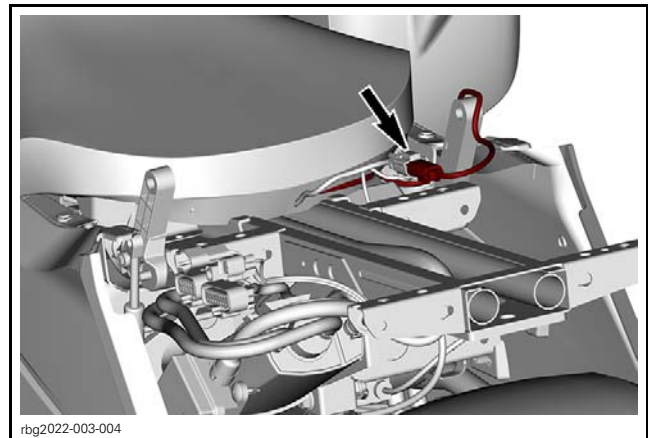


6. Remove and keep the LH upper fairing and the LH access covers.

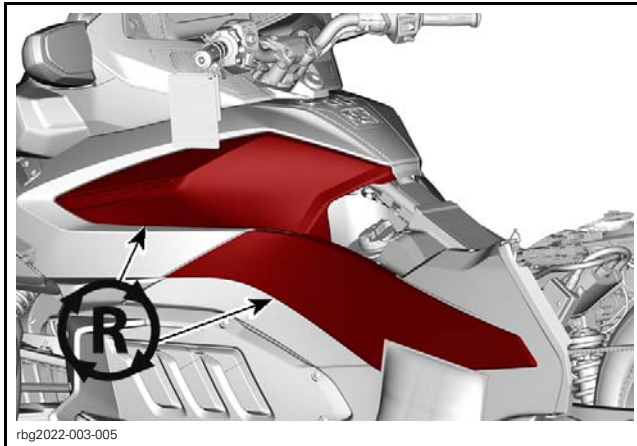

7. Remove and keep the 2 M6 X 20 screws and the 2 washers.

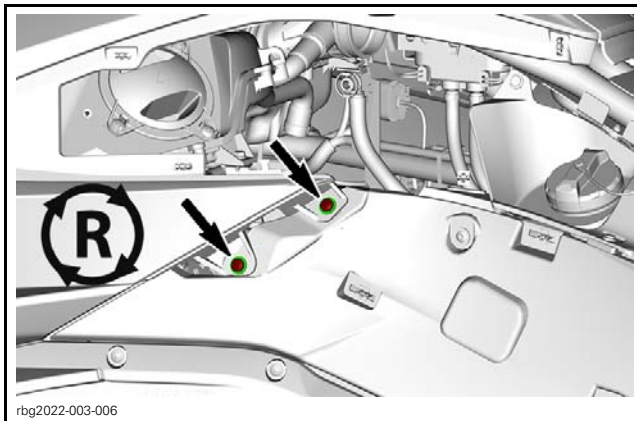


8. Remove and keep the M6 X 25 screw and the washer then remove and discard the polyfoam protective sheet from the LH passenger foot-board.

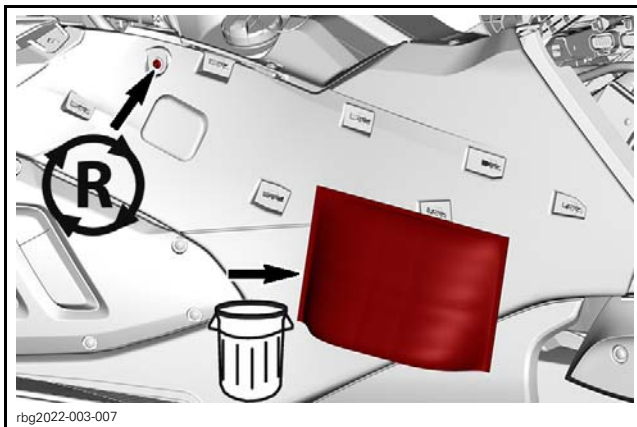


9. Remove and discard the 2 plastic rivets if present on the lower frame rail (driver floorboard area).


NOTE: Do not reinstall these plastic rivets on re-assembly on the lower frame rail (driver floorboard area).

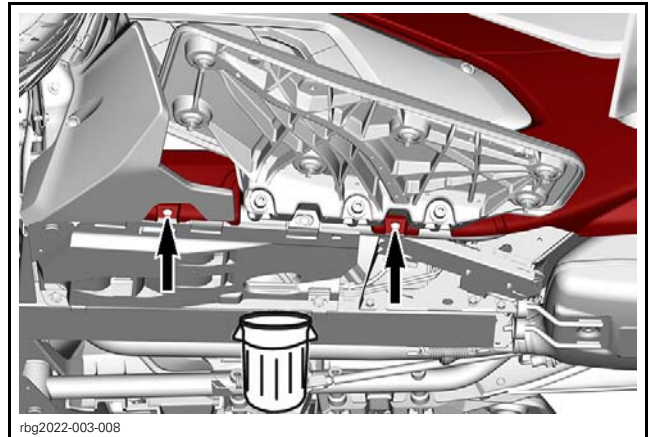



10. Remove and keep the passenger footrest ass'y: remove and keep the M8 X 55 screw and the washer.

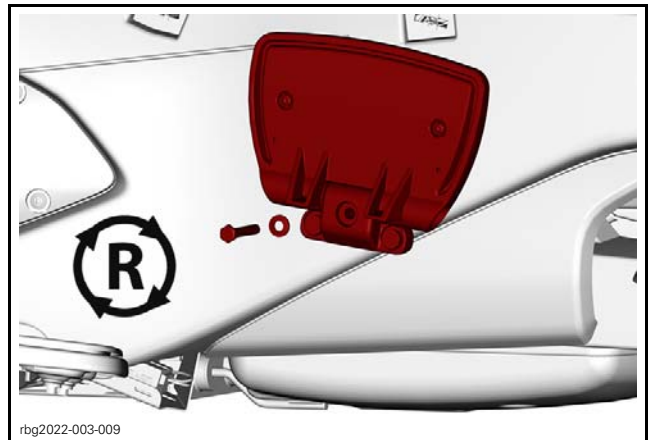

11. Remove and keep the 2 plastic rivets.

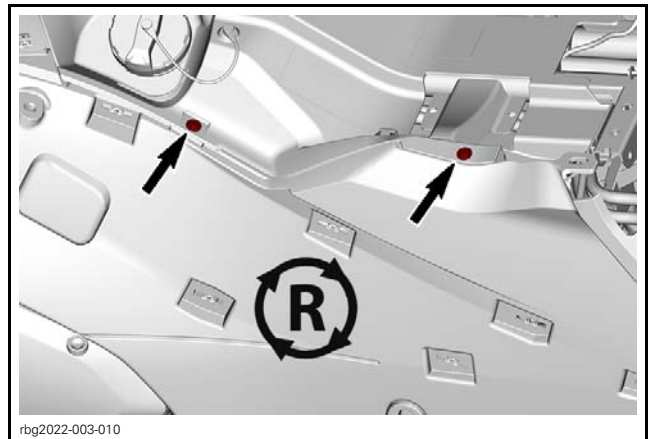

12. Install the adapter (P/N 705017687) on LH central fairing and use it as a template to enlarge the lower part of the hole. You may use a small rotary tool to enlarge the hole.

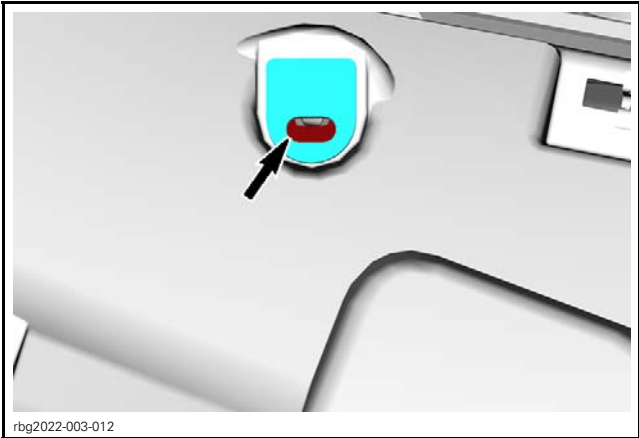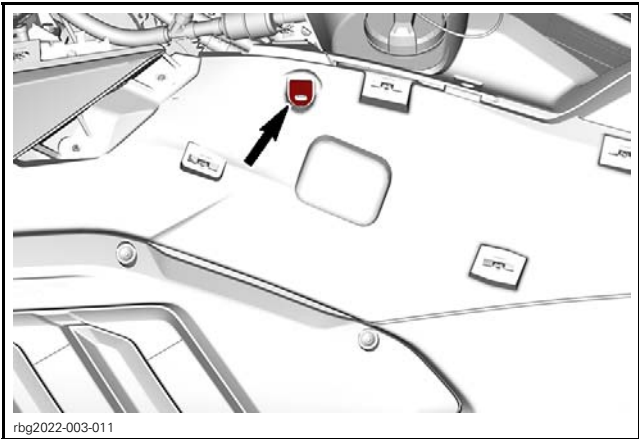



AREA TO BE ENLARGED THROUGH THE ADAPTER OPENING



13. Apply a light upward pressure approximately to the bottom center of the LH central fairing (right about the middle of the driver's footboard) which allows the fairing to be raised and adjust then secure using the

adapter (P/N 705017687), the previously removed M6 X 25 screw and washer. Tighten to specification.

TIGHTENING TORQUE	
M6 X 25 Screw	3.5 N•m ± 0.5 N•m (31 lbf•in ± 4 lbf•in)

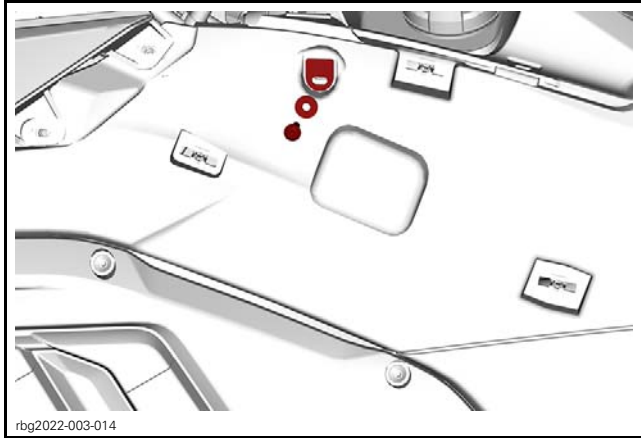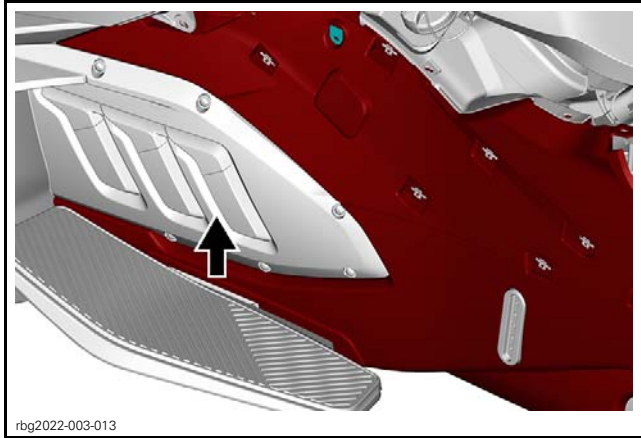

14. Reinstall all the previously removed body panels. Installation is the reverse of the removal procedure. However pay attention to the following: tighten the previously removed screws to specification.

TIGHTENING TORQUE	
M6 X 20 Screws	3.5 N•m ± 0.5 N•m (31 lbf•in ± 4 lbf•in)
M8 X 55 Screw	24.5 N•m ± 3.5 N•m (18 lbf•ft ± 3 lbf•ft)

15. Continue with the normal *SPYDER RT PRE-DELIVERY BULLETIN 2022-3* procedure.

WARRANTY

Submit a warranty claim using the following information.

For claiming procedure, refer to the **online** *DEALER/DISTRIBUTOR WARRANTY GUIDE*.

Product Line	Roadster
Unit Model Year	2022
Campaign/Bulletin/Description	5 / 2022-3 / RT Left Lateral Gap
*Action Inspect ☐ Repair ☒	
Total Labor time paid	0.3 hour
Expiration date	October 31, 2025