



Preliminary Information

PIP5757B Service Engine Soon Light/Message with DTCs P1967 or P1968 in the TCM

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Corvette	2020 - 2022	All	All	All	M1L

Involved Region or Country	North America
Condition	Service engine tell-tale or message with stored TCM DTCs or P1967 and or P1968
Cause	TCM Software anomaly

Some customers may comment on a service engine telltale, reduced engine power message with no noticeable performance issues. When scanning the vehicle for DTCs the technician may find P0700 stored in the ECM and P1967, P1968 stored in the TCM. If there are other DTC in the TCM diagnose those first as per service information.

For 2020 model years: If only DTCs P1967 or P1968 are set, then reprogram the transmission control module with the latest available software. If the latest software is already installed then perform a Service Fast Learn. If successful then no further action is required. If SFL fails note where it failed and diagnose related components.

For 2021-2022 model years: If only DTCs P1967 or P1968 are set then perform a Service Fast Learn. If successful then no further action is required. If SFL fails note where it failed and diagnose related components.

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2810175	Transmission Control Module Reprogramming with SPS	Use published labor time
8481938	Perform Service Fast Learn	.5 Hrs.

Version History

Version	3
Modified	10/12/2020 - Created on. 11/02/2020 - Updated repair information 03/04/2022 Update repair information add model years



GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.