



Preliminary Information

PIT5608E GMC Terrain/Chevy Equinox Seat movement, door lock cycle possible B3125, B3130 or B3135 stored

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018 - 2022	All	All	All	All
GMC	Terrain	2018 - 2022	All	All	All	All

Involved Region or Country:	North America
Condition:	Some customers may comment that they hear the door locks cycle on their own, their seat may move randomly without command, problems with the mirror adjustment switches or intermittent PEPS operation.
Cause:	Short circuit in one or more of the following connectors X500, x600, x700 or x800 due to water intrusion

Correction:

Check the condition of the x500, x600, x700 or x800 connectors and the mating body harness for signs of water intrusion.
 Repair as necessary.
 Evaluate the A-pillar body plug to ensure it is present and sealing properly. Engineering is investigating this sealing issue.
 If no concerns are observed refer to SI for further diagnosis.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation:	Description:	Labor Time:
2086118	Inspect Door Pass through Connectors For Water Intrusion	0.5 Hr.

Version History

Version	
4	03/23/2018 - Created on 07/03/18 - Updated to add DTC information. 10/30/2018 - Updated to add 2019 model year. 06/28/2019 - Updated to add 2020 Model year. 09/21/2020- Updated to add labor operation. 03/15/2022- Updated to add the 2021 and 22 Model years.



GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.