

#### 72 Noises from the second row seats

72 22 41 2060719/2 April 16, 2022. Supersedes Technical Service Bulletin Group 72 number 20-29 dated October 5, 2020, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment	
Q7	2017 – 2023	All	Neternieskis	
SQ7	2020 – 2023	All	Not applicable	

### Condition

REVISION HISTORY				
Revision	Date	Purpose		
2	-	Revised header (Added model years)		
		Revised Production Solution		
1	10/05/2020	Initial publication		

#### Customer states:

• The right and/or left second-row seat squeaks, rattles, or buzzes while driving.

#### Workshop findings:

The squeak/rattle/buzz noise originates from the area of the second-row seat locking plate in the floorboard when driving on rough roads.

## **Technical Background**

Driving on rough roads causes relative movement between the seat frame lock and the locking plate (striker) in the floorboard. The vibrations generated by this relative movement are then transferred through the locking plate and the seat lock resulting in squeak, rattle, and buzz concerns.

<sup>© 2022</sup> Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



### **Production Solution**

Not applicable.

### **Service**

Adjust the outer locking plate in the floorboard of the affected seat by following these steps:

 Fold and tilt the affected seat forward to gain access to the outer locking plate (Figures 1 – 2).



Figure 1. Affected second-row seat.



Figure 2. Affected seat unlatched and tilted forward.

© 2022 Audi of America, Inc.

Page 2 of 6

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prin expressed written permission of the publisher.



2 Remove the
trim of the
outer locking
plate (door
side) by
following the
repair
manuals in
Elsa (Figures
3 - 4).



Figure 3. Outer and inner locking plate with trim installed.



Figure 4. Outer locking plate trim removal.

© 2022 Audi of America, Inc.

Page 3 of 6

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prin expressed written permission of the publisher.



3 Loosen both
bolts of the locking plate and then move the locking plate evenly towards the rear of the vehicle by approximatel y 1.2mm (~ 3/64 inches) (Figures 5 -6).

> **Tip:** Mark the location of the locking plate prior to loosening the bolts.



Figure 5. Outer locking plate with trim removed.

© 2022 Audi of America, Inc.

Page 4 of 6

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.





### Figure 6. Adjustment of outer locking plate.

4 Tighten the locking plate bolts according to the repair manuals and reinstall the locking plate trim.

Warning: Do not add tape or any other material to the locking plate. Adding tape/material could negatively affect the function of the seat latch and thus result in serious personal injury or death!

- 5 Latch and unlatch the affected seat several times to verify that the seat properly latches in both locking plates.
- 6 Adjust the seat forward and backward several times to verify that the inner and outer seat rails of the affected
- . seat latch simultaneously.

### Warranty

Claim Type:	• 110 up to 48 Months/50,000 Miles.	
	G10 for CPO Covered Vehicles – Verify Owner.	
	• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.	
Service Number:	7255	

<sup>© 2022</sup> Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Damage Code:	0020			
Labor Operations:	Rework 1 second row seat frame	7255 4999	20 TU	
	Rework 2 second row seat frames	7255 5099	30 TU	
Diagnostic Time:	GFF	No allowance	0 TU	
	Road test prior to the service procedure	0121 0002	10 TU	
	Road test after the service procedure	0121 0004	10 TU	
Claim Comment:	As per TSB 2060719/2			

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## **Additional Information**

All part and service references provided in this TSB (**2060719**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

**©2022** Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

© 2022 Audi of America, Inc.

Page 6 of 6

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prin expressed written permission of the publisher.