

SS 725-WST 2022 Power Steering Cap Contact with Hood Strap

Applicable Vehicles

49X & 47X vehicles equipped with 4qt power steering reservoir

Symptoms

Power steering cap may become loose/detached or missing.


Issue

Under certain conditions the drivers side hood restraint strap, which is attached to the radiator and hood, may become lodged behind the power steering cap. When opening the hood, the hood restraint strap may pull on the power steering cap resulting in the cap coming off of the reservoir.

Solution

Removal of compression ring bushing from the radiator side of the hood restraint strap installation and torque mounting nuts with restraint strap buckle facing forward per information below:

1. Open hood
2. Remove compression ring bushing (item 3 below)
3. Reinstall strap to radiator stud, leave nut loose
4. Allow hood to rest on restraint straps with hood in full open position and assure the buckle is facing forward
5. Torque nut to 24 ft/lbs

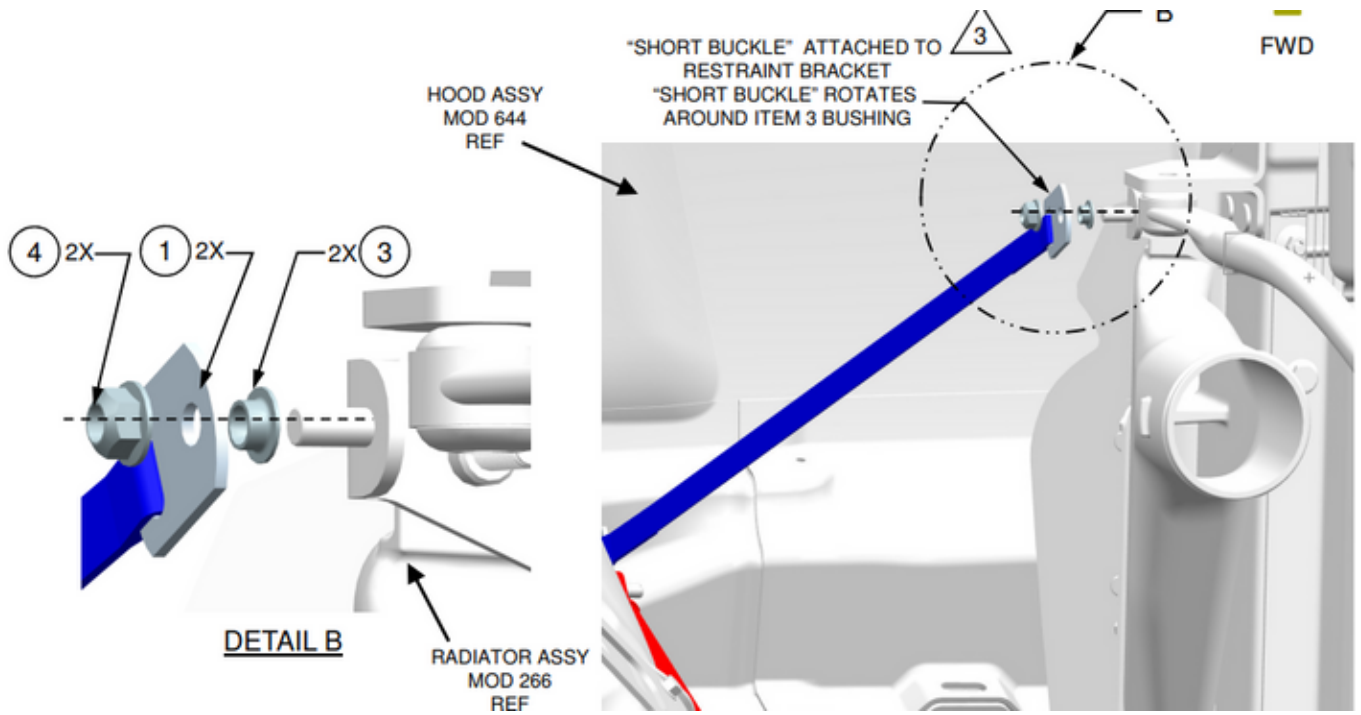

Labels :

49X

Add tags



2 Kudos

Comment