



Technical Service Bulletin

48 Yellow steering malfunction light is on in the cluster, DTC C110DF0 is stored in the active steering module

48 22 30 2061904/4 April 28, 2022. Supersedes Technical Service Bulletin Group 48 number 21-02 dated June 4, 2021, for reasons listed below.

| Model(s) | Year | VIN Range | Vehicle-Specific Equipment |
|----------|------|-----------|----------------------------|
|----------|------|-----------|----------------------------|



Technical Service Bulletin

| | | | |
|--|----------------------------|-----|----------------|
| A4 and A4 allroad | 2017 – 2023 | All | Not applicable |
| S4, A5 Cabriolet, A5, A5 Sportback, S5 Cabriolet, S5, and S5 Sportback | 2018 – 2023 | | |
| RS 5 | 2018 – 2019 2021 – 2023 | | |
| A6, A7 and A8 | 2019 – 2023 | | |
| RS 5 Sportback | 2019 2021 – 2023 | | |
| A6 allroad, S6, S7 and S8 | 2020 – 2023 | | |
| A8 e quattro | 2020 – 2021 | | |
| RS 6, and RS 7 | 2021 – 2023 | | |
| A7 e quattro | 2021 - 2022 | | |

Condition

| REVISION HISTORY | | |
|------------------|------|-----------------------------------|
| Revision | Date | Purpose |
| 4 | - | Revised header (Added model year) |



Technical Service Bulletin

| | | |
|---|------------|---|
| 3 | 06/04/2021 | Revised header (Added model year) |
| 2 | 05/04/2021 | Revised <i>Warranty</i> (Added Labor Operation) |

Customer states:

- The yellow steering lamp is on in the instrument cluster.

Workshop findings:

- The customer's statement can be reproduced.

The following DTC is stored in the active steering control module, J792 (address word 001B):

- DTC C110DF0 (Active steering safety lock locking failed) with symptom code 13568.

Technical Background

There is a hardware function restriction.

Production Solution

Not applicable.

Service

Install the repair kit for the steering column lock magnet according to the Elsa repair manual: *Chassis >> Suspension, Wheels, Steering >> 48 Steering >> Steering Column >> Active Steering Safety Lock, Removing and Installing.*

Warranty

| | |
|-------------|--|
| Claim Type: | <ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner. |
|-------------|--|



Technical Service Bulletin

| | | | |
|-------------------|--|--------------|--|
| | <ul style="list-style-type: none">If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. | | |
| Service Number: | 4869 | | |
| Damage Code: | 0016 | | |
| Labor Operations: | Steering lock removal + reinstall | 4819 1905 | See SRT with associated operations |
| | Vehicle front + rear check | 4495 0150 | See SRT with associated operations |
| Diagnostic Time: | GFF | 0150 0000 | Time stated on the diagnostic protocol |
| | Road test prior to the service procedure | No allowance | 0 TU |
| | Road test after the service procedure | No allowance | 0 TU |
| Claim Comment: | As per TSB 2061904/4 | | |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

| Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. | | |
|---|--|---------------|
| Part Number | Part Description | Quantity |
| See ETKA | Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual | See ETKA/ELSA |



Technical Service Bulletin

| | | |
|-----------|----------------------------|----|
| 8W0927289 | Repair kit for lock magnet | 01 |
|-----------|----------------------------|----|

Additional Information

More information on this system can be found in the following resources:

- Elsa: Chassis >> Suspension, Wheels, Steering >> 48 Steering >> Steering Column >> Active Steering Safety Lock, Removing and Installing.

All parts and service references provided in this TSB (2061904) are subject to change and/or removal.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.