



Service Bulletin

Bulletin No.: 22-NA-027

Date: April, 2022

TECHNICAL

Subject: LM2 Diesel With Possible Oil Consumption - DTC P06DD Set

The bulletin replaces PIP5762. Please discard PIP5762.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2021	2022			LM2	
Chevrolet	Silverado 1500	2020	2021				
	Silverado 1500 - (LTD, RPO J21, 12th VIN Digit = 4 or less)	2022	2022				
	Silverado 1500 - (RPO J22, 12th VIN Digit = 5 or greater)						
	Suburban	2021	2022				
	Tahoe						
GMC	Sierra 1500	2020	2021				
	Sierra 1500 - (LIMITED, RPO J21, 12th VIN Digit = 4 or less)	2022	2022				
	Sierra 1500 - (RPO J22, 12th VIN Digit = 5 or greater)						
	Yukon Models	2021	2022				

<p>Involved Region or Country</p>	<p>North America, Russia, Middle East, Chile (West), Colombia (West), Ecuador (West), Paraguay (West), Peru (West), Japan, Cadillac Korea (South Korea), Thailand (ASEAN), Australia/New Zealand</p>
<p>Condition</p>	<p>Some customers may comment on oil consumption. Some technicians may find DTC P06DD set.</p>
<p>Cause</p>	<p>Camshaft housing (cover) may have a baffle plate weld that is not adequate.</p>
<p>Correction</p>	<div style="text-align: right; margin-bottom: 10px;">5671019</div>  <div style="text-align: right; margin-bottom: 10px;">5671020</div>  <ul style="list-style-type: none"> • If the serial number is greater than 21298JDXXX, this bulletin does not apply. Refer to bulletin 21-NA-272 and SI for appropriate diagnostics. • If the serial number is less than 21298JDXXX and the customer's concern is oil consumption: <ol style="list-style-type: none"> 1. Replace the camshaft housing cover. 2. Replace the #2 glow plug. <p>Re-evaluate the oil consumption.</p>

Service Procedure

Refer to *Camshaft Housing Replacement* in the Service Manual and *Glow Plug Replacement - Cylinder 2* in the Service Manual.

Parts Information

Use the vehicle identification number (VIN), SI, and the GM Electronic Parts Catalog to determine the correct part to order.

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Model	Labor Time
4087688*	Replace Camshaft Housing and Glow Plug	Silverado 1500 Sierra 1500	8.1 hr
		Escalade Models Suburban Tahoe Yukon Models	12.2 hr
*This is a unique Labor Operation for Bulletin use only.			

Version	2
Modified	Released February 02, 2022 Revised April 19, 2022 - Update Cell-Link in Service Procedure and Update Labor Time in Warranty Information section.

