



# Technical Service Bulletin

---

90 DTC B200043 is stored in the head-up display (HUD)

90 22 62 2064963/3 May 11, 2022. Supersedes Technical Service Bulletin Group 90 number 21-24 dated November 17, 2021, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e-tron GT	2022	All	Head Up Display

## Condition

REVISION HISTORY		
Revision	Date	Purpose
3		Revised Header (corrected software version filter) Revised Service (updated flash table)
2	11/17/2021	Revised <i>Service</i> (Added Note)
1	11/17/2021	Initial publication

Customer states:

- No customer concerns, it is found during PDI or any other diagnostic work.

OR

- The head-up display (HUD) is not working.

Workshop findings:

The following DTC is stored in the head-up display (HUD), J898 (address word 0082):

DTC B200043 (Control Module Faulty).

## Technical Background



# Technical Service Bulletin

---

There is a software bug in the HUD.

## Production Solution

Software 0101 has been released in the current series production.

## Service



Applies to vehicles with high-voltage components:

To prevent charging of the high-voltage battery during the software update, the high-voltage cable is to be removed BEFORE entry of the SVM code on vehicles with high-voltage components.

Charging the high-voltage battery during a software update can damage the high-voltage components.

### SVM Update Instructions

1. If the HUD is inoperable, reset it by removing fuse SO4 for approximately five minutes and replacing it afterward.
2. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
3. Update the HUD, J898 (address word 0082) using the SVM action code as listed in the table below, if necessary:

Model	Old Software Part Number	Old Software Version	New Software Part Number (or higher)	New Software Version (or higher)	SVM Code Input
Audi e-tron GT, Audi RS e-tron GT	4J3919617	0037			
		0101	4J3919617		
	4J3919618	0102	4J3919618	0105	82A003
		0104			

## Warranty

---



# Technical Service Bulletin

Claim Type:	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• G10 for CPO Covered Vehicles – Verify Owner.</li><li>• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>		
Service Number:	9091		
Damage Code:	0040		
Labor Operations:	Software Update (Includes checking for DTCs)	0151 0000	Time stated on the diagnostic protocol (Max 100 TU)
	Repair control unit for head-up display	9091 4199	20 TU
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 50 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2064963/3		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*



# Technical Service Bulletin

---

All part and service references provided in this TSB (2064963) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.