



Service Campaign 488 M161 MY21-22 - Potential Maserati Logo Detachment



DATE: April 5 2022

Maserati Levante (M161) MY21-22 vehicles are involved in a Service Campaign to prevent the detachment of the front hood Maserati EMBLEM.

This event could occur due to insufficient coupling between the EMBLEM and its support, so the gluing could be compromised.

In case of poor connection, a special procedure has been developed to ensure optimal adherence and eliminate any risk of detachment of the Maserati EMBLEM.

For the new production cars, a new coupling procedure has been implemented to prevent any risk of detachment.

If you have any questions, contact your Regional AfterSales Manager or the Technical Support Helpdesk.

Technical Procedure


1. Always check in ModisCS+ to see if the vehicle is involved in this campaign and if the campaign has not been previously performed.
2. Protect the area around the EMBLEM with masking tape.
3. Check if the Maserati EMBLEM can be easily detached from its holder using a suction cup or a suitable Teflon wedge. May need to apply little force for the inspection.



- If the inspection is GOOD and the EMBLEM adhesion is strong. The inspection procedure is finished.
- If the inspection is NO GOOD and the EMBLEM is loose and detaches from the holder. Proceed with

Step 4.

4. Remove the EMBLEM from the holder and clean the area between the holder and the EMBLEM with Isopropyl - alcohol wipes. Clean off all glue residue, then allow it to dry for 5 minutes.

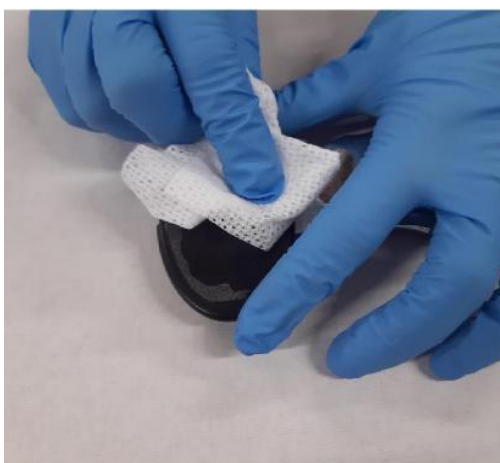

5. The sealants listed below are approved by the factory and must be purchased locally:

USABLE SEALANTS
Dowsil 7091
Loctite 5900
Loctite 5970
Threebond 1227E
Simson ISR 7003
Simson ISR 7008
Teroson MS 932
Teroson MS 935
Teroson MS 9360

6. Apply a bead of sealant, diameter 5 mm, length 25 mm, to the EMBLEM holder.



7. Carefully apply the painted aluminum EMBLEM on the plastic support holder and apply slight pressure with one hand. Make sure sealant does not squeeze out the sides of the EMBLEM.



8. After bonding and ensure proper curing:
- Do not open and close the hood for 4 hours
 - The vehicle can be moved within the shop only
 - Keep the car in a dry area (no rain!) at a minimum of 12°C (53.6°F) for at least 12 hours
9. Procedure is completed.

Entering a Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Campaign Number	488
Warranty Code	23
Fault Code	063
Component Code	9.16.054
Operation Code:	
Check	9.16.054.A (0,05h)
Check + Rework*	9.16.054.B (0,30h)*

* The reimbursed time has been increased by 0.10h compared to the effective rework time to compensate for the reimbursement of the minimum amount of sealant used