



STAR ONLINE PUBLICATION




Case Number: S2208000063

Release Date: March 2022

Symptom/Vehicle Issue: Loss of power steering assist. U0131 Lost Communication With Electric Power Steering Control Module

Discussion: The customer may experience a lack of power steering assist. Upon scanning the vehicles for DTC's you may find U0131 - Lost Communication With Electric Power Steering Control Module. This may be caused by the ground wire not being fully welded/secured to the ground eyelet.

Diagnosis: Inspect the G908A ground located behind the passenger side headlight. Determine if the ground eyelet is properly secured to the ground wire.

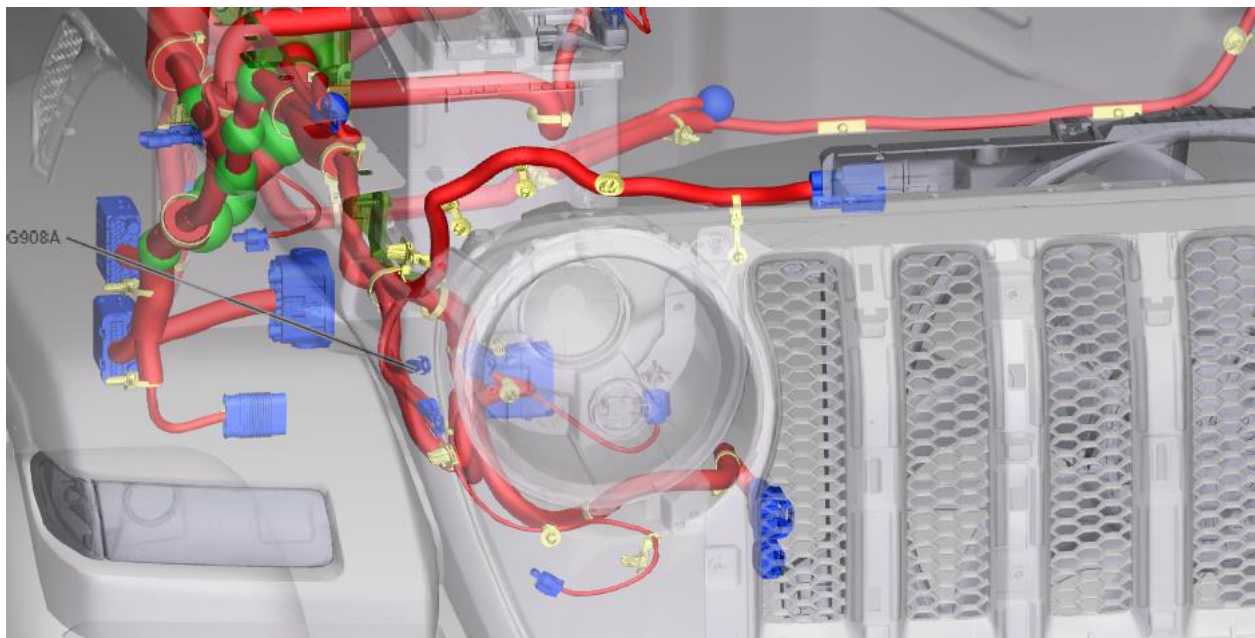

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found



STAR ONLINE PUBLICATION



Repair Procedure: It is recommended to spot solder the ground wire onto the eyelet terminal.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found